



# 38DL PLUS

## Ultrasonic Thickness Gage

Basic Operation Manual

DMTA-10009-01EN [U8778346] — Rev. D  
November 2016

This instruction manual contains essential information on how to use this Olympus product safely and effectively. Before using this product, thoroughly review this instruction manual. Use the product as instructed.

Keep this instruction manual in a safe, accessible location.

Olympus Scientific Solutions Americas, 48 Woerd Avenue, Waltham, MA 02453, USA

Copyright © 2010, 2011, 2016 by Olympus. All rights reserved. No part of this publication may be reproduced, translated, or distributed without the express written permission of Olympus.

This document was prepared with particular attention to usage to ensure the accuracy of the information contained therein, and corresponds to the version of the product manufactured prior to the date appearing on the title page. There could, however, be some differences between the manual and the product if the product was modified thereafter.

The information contained in this document is subject to change without notice.

Part number: DMTA-10009-01EN [U8778346]

Rev. D

November 2016

Printed in the United States of America

All brands are trademarks or registered trademarks of their respective owners and third party entities.

---

---

# Table of Contents

---

<b>List of Abbreviations .....</b>	<b>vii</b>
<b>Labels and Symbols .....</b>	<b>1</b>
<b>Important Information – Please Read Before Use .....</b>	<b>5</b>
Intended Use .....	5
Instruction Manual .....	5
Instrument Compatibility .....	6
Repair and Modification .....	7
Safety Symbols .....	7
Safety Signal Words .....	7
Note Signal Words .....	8
Safety .....	9
Warnings .....	9
Battery Precautions .....	10
Equipment Disposal .....	11
CE (European Community) .....	11
WEEE Directive .....	12
China RoHS .....	12
EMC Directive Compliance .....	13
FCC (USA) Compliance .....	13
ICES-001 (Canada) Compliance .....	14
Regulatory Information .....	14
Warranty Information .....	14
Technical Support .....	15
<b>Introduction .....</b>	<b>17</b>
<b>1. Instrument Description .....</b>	<b>19</b>

1.1	Product Description .....	19
1.2	Environmental Ratings .....	22
1.3	Instrument Hardware Components .....	23
1.4	Connectors .....	24
1.5	Keypad Functions .....	26
<b>2.</b>	<b>Powering the 38DL PLUS .....</b>	<b>31</b>
2.1	Power Indicator .....	31
2.2	Using the AC Power .....	32
2.3	Using Battery Power .....	33
2.3.1	Battery Operating Time .....	34
2.3.2	Charging the Battery .....	34
2.3.3	Replacing the Battery .....	36
<b>3.</b>	<b>Software User Interface Elements .....</b>	<b>39</b>
3.1	Measurement Screen .....	39
3.2	Menus and Submenus .....	41
3.3	Parameter Screens .....	42
3.4	Selecting the Text Edit Mode .....	44
3.4.1	Editing Text Parameters Using the Virtual Keyboard .....	44
3.4.2	Editing Text Parameters Using the Traditional Method .....	46
<b>4.</b>	<b>Initial Setup .....</b>	<b>49</b>
4.1	Setting the User Interface Language and Other System Options .....	49
4.2	Selecting the Measurement Units .....	50
4.3	Setting the Clock .....	50
4.4	Changing Display Settings .....	51
4.4.1	Color Schemes .....	52
4.4.2	Display Brightness .....	53
4.4.3	Waveform Rectification .....	54
4.4.4	Waveform Trace .....	55
4.5	Range of the Waveform Display .....	56
4.5.1	Selecting the Range Value .....	57
4.5.2	Adjusting the Delay Value .....	58
4.5.3	Activating the Zoom Function .....	58
4.6	Adjusting the Measurement Update Rate .....	60
4.7	Changing the Thickness Resolution .....	61
<b>5.</b>	<b>Basic Operation .....</b>	<b>63</b>
5.1	Setting Up the Transducer .....	63
5.2	Calibration .....	66

---

5.2.1	Calibrating the Instrument .....	67
5.2.2	Test Blocks .....	70
5.2.3	Transducer Zero Compensation .....	70
5.2.4	Material Sound Velocity and the Zero Calibrations .....	71
5.2.5	Entering a Known Material Sound Velocity .....	72
5.2.6	Locked Calibrations .....	73
5.2.7	Factors Affecting the Performance and the Accuracy .....	73
5.3	Measuring Thicknesses .....	75
5.4	Saving Data .....	76
5.5	Measurements with THRU-COAT D7906 and D7908 Transducers .....	78
5.5.1	Enabling the THRU-COAT Function .....	78
5.5.2	Performing a THRU-COAT Calibration .....	79
5.6	Echo Detection Modes with Dual Element Transducers .....	80
5.6.1	Blanking Adjustments in Manual Echo-to-Echo Detection Mode .....	83
5.6.2	Dual Element Transducer Selection in Echo-to-Echo Modes .....	84
5.6.3	Echo-to-Echo Mode Datalogger Flags .....	85
5.7	Using the VGA Output .....	86
<b>Appendix: Technical Specifications .....</b>		<b>87</b>
<b>List of Figures .....</b>		<b>95</b>
<b>List of Tables .....</b>		<b>97</b>
<b>Index .....</b>		<b>99</b>



---

## List of Abbreviations

---

AC	alternative current
AEToE	automatic echo-to-echo
AVG	average
DB	database
DC	direct current
EFUP	environment-friendly use period
EMAT	electromagnetic acoustic transducer
HI	high
ID	identification
Li-ion	lithium-ion
LOS	loss-of-signal
MB	main bang
MEtoE	manual echo-to-echo
MIL	military
NiMH	nickel metal hydride
P/N	part number
PDF	portable document format
PRF	pulse repetition frequency
SP	special
STD	standard
TFT	thin film transistor (liquid crystal display technology)
USB	universal serial bus
VAC	voltage alternative current



---

## Labels and Symbols

---


Safety-related labels and symbols are attached to the instrument at the locations shown in Figure i-1 on page 1 and Figure i-2 on page 2. If any or all of the labels or symbols are missing or illegible, please contact Olympus.




### CAUTION

Do not touch the inner conductor of the T/R 1 and T/R 2 connectors to avoid risks of an electric shock. Up to 200 V can be present on the inner conductor. The warning symbol between the Transmit/Receive (T/R) connector markings is shown in Figure i-1 on page 1.

---

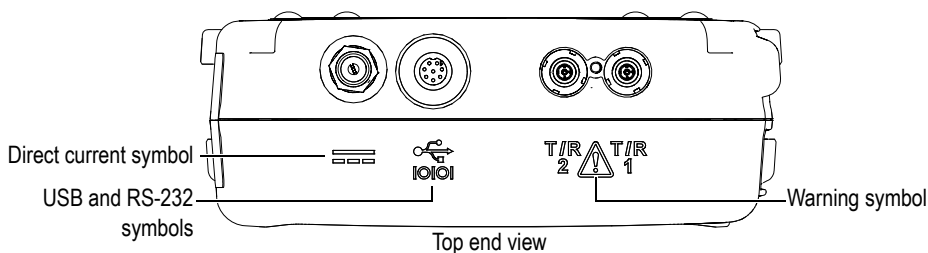

**Figure i-1 The warning symbol between the T/R connectors**

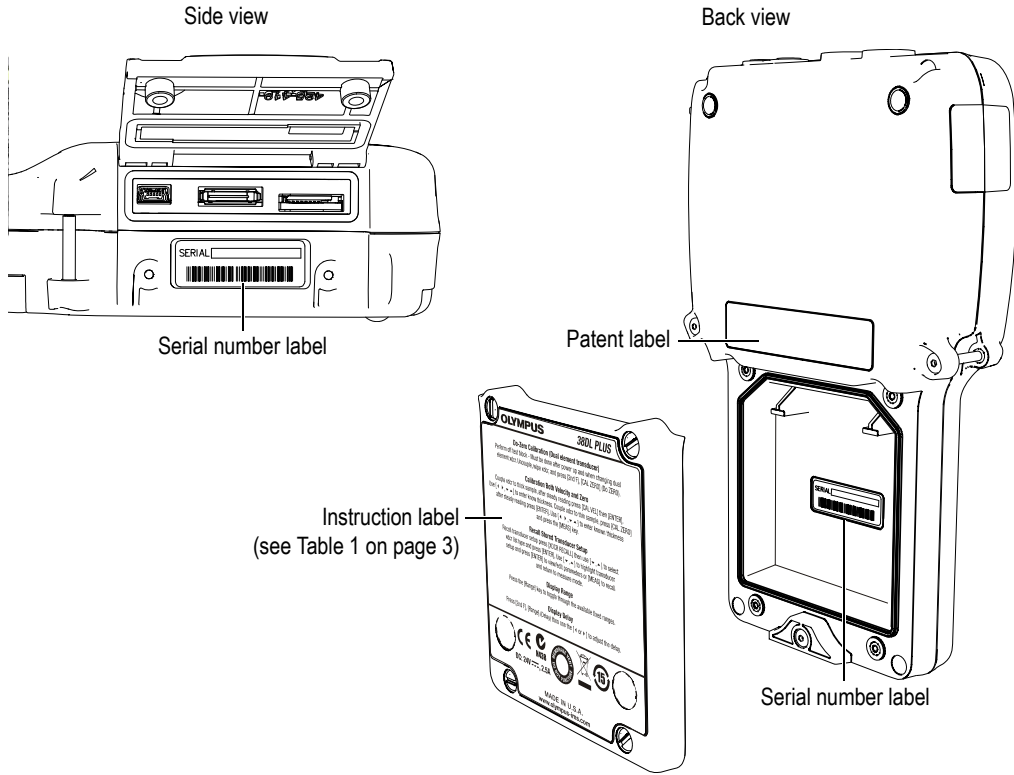

**Figure i-2 Labels and symbols are attached to the instrument**

Table 1 Label contents









 
Serial number label	 <p>Where:</p> <p><b>yy</b>: last two digits of the production year</p> <p><b>nnnnn</b>: 5-digit nonduplicated incrementing number representing the n<sup>th</sup> production unit of this product</p> <p><b>mm</b>: production month</p>
Instruction label	 <p><b>OLYMPUS 38DL PLUS</b></p> <p><b>Do-Zero Calibration (Dual element transducer)</b> Perform off test block - Must be done after power up and when changing dual element xdcr. Uncouple, wipe xdcr, and press [2nd F], [CAL ZERO] (Do ZERO).</p> <p><b>Calibration Both Velocity and Zero</b> Couple xdcr to thick sample, after steady reading press [CAL VEL] then [ENTER]. Use [◀ ▶, ▼ ▲] to enter know thickness. Couple xdcr to thin sample, press [CAL ZERO] after steady reading press [ENTER]. Use [◀ ▶, ▼ ▲] to enter known thickness and press the [MEAS] key.</p> <p><b>Recall Stored Transducer Setup</b> Recall transducer setup press [XDCR RECALL] then use [▼, ▲] to select xdcr list type and press [ENTER]. Use [▼, ▲] to highlight transducer setup and press [ENTER] to view/edit parameters or [MEAS] to recall and return to measure mode.</p> <p><b>Display Range</b> Press the [Range] key to toggle through the available fixed ranges.</p> <p><b>Display Delay</b> Press [2nd F], [Range] (Delay) then use the [◀ or ▶] to adjust the delay.</p> <p>DC: 24V ---, 2.5A</p> <p>DO NOT PUNCTURE</p> <p>15</p> <p>FC</p> <p>MADE IN U.S.A. www.olympus-ims.com</p>

Table 1 Label contents (*continued*)

Symbol	Description
	The CE marking is a declaration that this product conforms to all the applicable directives of the European Community. See the <i>Declaration of Conformity</i> for details. Contact your Olympus representative for more information.
	The regulatory compliance mark (RCM) label indicates that the product complies with all applicable standards, and has been registered with the Australian Communications and Media Authority (ACMA) for placement on the Australian market.
	This symbol indicates the location of the membrane vent.
	The WEEE symbol indicates that the product must not be disposed of as unsorted municipal waste, but should be collected separately.
	The China RoHS mark indicates the product's Environment-Friendly Use Period (EFUP). The EFUP is defined as the number of years for which listed controlled substances will not leak or chemically deteriorate while in the product. The EFUP for the 38DL PLUS has been determined to be 15 years. <b>Note:</b> The Environment-Friendly Use Period (EFUP) is not meant to be interpreted as the period assuring functionality and product performance.
	This device complies with Part 15 of the FCC Rules. Operation is subject to the following two conditions: (1) this device may not cause harmful interference, and (2) this device must accept any interference received, including interference that may cause undesired operation.
	The direct current symbol.

---

## Important Information — Please Read Before Use

---

### Intended Use

The 38DL PLUS instrument has been designed to measure thicknesses of industrial and commercial materials.



#### **WARNING**

Do not use the 38DL PLUS for any purpose other than its intended use. It must never be used to inspect or examine human or animal body parts.

---

### Instruction Manual

This instruction manual contains essential information on how to use this Olympus product safely and effectively. Before using this product, thoroughly review this instruction manual. Use the product as instructed.

Keep this instruction manual in a safe, accessible location.

---

**IMPORTANT**

Some of the details of components and/or software images in this manual may differ from your instrument's components or software display. However, the principles remain the same.

---

The other 38DL PLUS documents are:

*38DL PLUS Ultrasonic Thickness Gage — Getting Started* (P/N: DMTA-10010-01EN [U8778357])

A short leaflet containing essential information on how to quickly start operating the 38DL PLUS instrument.

*38DL PLUS Ultrasonic Thickness Gage — User's Manual* (P/N: DMTA-10004-01EN)

A document in PDF format containing the detailed description of the instrument as well as the setup and operation procedures for all instrument features. The PDF file can be found on the GageView CD (P/N: Gageview [U8147006]).

*GageView Interface Program — User's Manual* (P/N: 910-259-EN [U8778347])

The 38DL PLUS also works with the GageView interface program. Refer to this document for detailed information on GageView. The document is available in PDF format on the GageView CD and as online help in GageView.

## Instrument Compatibility

Refer to the *User's Manual* for information on accessories that are compatible with the 38DL PLUS instrument.

---



**CAUTION**

Always use equipment and accessories that meet Olympus specifications. Using incompatible equipment could cause equipment malfunction and/or damage, or human injury.

---

## Repair and Modification

Apart from the battery, the 38DL PLUS does not contain any user-serviceable parts. Opening the instrument might void the warranty.



### CAUTION

In order to prevent human injury and/or equipment damage, do not disassemble, modify, or attempt to repair the instrument.

---

## Safety Symbols

The following safety symbols might appear on the instrument and in the instruction manual:



General warning symbol

This symbol is used to alert the user to potential hazards. All safety messages that follow this symbol shall be obeyed to avoid possible harm or material damage.



Shock hazard caution symbol

This symbol is used to alert the user to potential electric shock hazards. All safety messages that follow this symbol shall be obeyed to avoid possible harm.

## Safety Signal Words

The following safety symbols might appear in the documentation of the instrument:



**DANGER**

The DANGER signal word indicates an imminently hazardous situation. It calls attention to a procedure, practice, or the like that if not correctly performed or adhered to will result in death or serious personal injury. Do not proceed beyond a DANGER signal word until the indicated conditions are fully understood and met.



**WARNING**

The WARNING signal word indicates a potentially hazardous situation. It calls attention to a procedure, practice, or the like that if not correctly performed or adhered to could result in death or serious personal injury. Do not proceed beyond a WARNING signal word until the indicated conditions are fully understood and met.



**CAUTION**

The CAUTION signal word indicates a potentially hazardous situation. It calls attention to a procedure, practice, or the like that if not correctly performed or adhered to may result in minor or moderate personal injury, material damage, particularly to the product, destruction of part or all of the product, or loss of data. Do not proceed beyond a CAUTION signal word until the indicated conditions are fully understood and met.

## Note Signal Words

The following symbols could appear in the documentation of the instrument:

**IMPORTANT**

The IMPORTANT signal word calls attention to a note that provides important information, or information essential to the completion of a task.

**NOTE**

The NOTE signal word calls attention to an operating procedure, practice, or the like, which requires special attention. A note also denotes related parenthetical information that is useful, but not imperative.

**TIP**

The TIP signal word calls attention to a type of note that helps you apply the techniques and procedures described in the manual to your specific needs, or provides hints on how to effectively use the capabilities of the product.

## Safety

Before turning on the instrument, verify that the correct safety precautions have been taken (see the following warnings). In addition, note the external markings on the instrument, which are described under “Safety Symbols.”

## Warnings

**WARNING**

### General Warnings

- Carefully read the instructions contained in this instruction manual prior to turning on the instrument.
- Keep this instruction manual in a safe place for further reference.
- Follow the installation and operation procedures.
- It is imperative to respect the safety warnings on the instrument and in this instruction manual.
- If the equipment is used in a manner not specified by the manufacturer, the protection provided by the equipment could be impaired.
- Do not install substitute parts or perform any unauthorized modification to the instrument.
- Service instructions, when applicable, are for trained service personnel. To avoid the risk of electric shock, do not perform any work on the instrument unless qualified to do so. For any problem or question regarding this instrument, contact Olympus or an authorized Olympus representative.
- Do not touch the connectors directly by hand. Otherwise, a malfunction or electric shock may result.

- Do not allow metallic or foreign objects to enter the device through connectors or any other openings. Otherwise, a malfunction or electric shock may result.



## WARNING

### Electrical Warnings

- Before operating this instrument using mains electricity, you must connect the protective earth terminal of the instrument to the protective conductor (mains) of the power cord. The mains plug shall only be inserted into a socket outlet provided with a protective earth contact. Never negate the protective action by using an extension cord (power cable) without a protective conductor (grounding).
- If there is any possibility that the ground protection could be impaired, you must make the instrument inoperative and secure it against any unintended operation.
- The instrument must only be connected to a power source corresponding to the type indicated on the rating label.



## CAUTION

If an unauthorized power supply cord is used to power the instrument or charge the batteries, Olympus cannot guarantee the electrical safety of the equipment.

### Battery Precautions



## CAUTION

- Before disposing of a battery, check your local laws, rules, and regulations, and follow them accordingly.
- Transportation of lithium-ion batteries is regulated by the United Nations under the United Nations Recommendations on the Transport of Dangerous Goods. It is expected that governments, intergovernmental organizations, and other international organizations shall conform to the principles laid down in these regulations, thus contributing to worldwide harmonization in this field. These international organizations include the International Civil Aviation organization

(ICAO), the International Air Transport Association (IATA), the International Maritime Organization (IMO), the US Department of Transportation (USDOT), Transport Canada (TC), and others. Please contact the transporter and confirm current regulations before transportation of lithium-ion batteries.

- Do not open, crush, or perforate batteries; doing so could cause injury.
- Do not incinerate batteries. Keep batteries away from fire and other sources of extreme heat. Exposing batteries to extreme heat (over 80 °C) could result in an explosion or personal injury.
- Do not drop, hit, or otherwise abuse a battery, as doing so could expose the cell contents, which are corrosive and explosive.
- Do not short-circuit the battery terminals. A short circuit could cause injury and severe damage to a battery making it unusable.
- Do not expose a battery to moisture or rain; doing so could cause an electric shock.
- Only use the 38DL PLUS unit or an external charger approved by Olympus to charge the batteries.
- Only use batteries supplied by Olympus.
- Do not store batteries that have less than 40 % remaining charge. Recharge batteries to between 40 % and 80 % capacity before storing them.
- During storage, keep the battery charge between 40 % and 80 %.
- Do not leave batteries in the 38DL PLUS unit during instrument storage.

## Equipment Disposal


Before disposing of the 38DL PLUS, check your local laws, rules, and regulations, and follow them accordingly.

## CE (European Community)



This device complies with the requirements of both directive 2014/30/EU concerning electromagnetic compatibility and directive 2014/35/EC concerning low voltage. The CE marking indicates compliance with the above directives.

## WEEE Directive

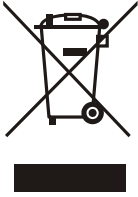

In accordance with European Directive 2012/19/EU on Waste Electrical and Electronic Equipment (WEEE), this symbol indicates that the product must not be disposed of as unsorted municipal waste, but should be collected separately. Refer to your local Olympus distributor for return and/or collection systems available in your country.

## China RoHS

*China RoHS* is the term used by industry generally to describe legislation implemented by the Ministry of Information Industry (MII) in the People's Republic of China for the control of pollution by electronic information products (EIP).



The China RoHS mark indicates the product's Environment-Friendly Use Period (EFUP). The EFUP is defined as the number of years for which listed controlled substances will not leak or chemically deteriorate while in the product. The EFUP for the 38DL PLUS has been determined to be 15 years.

**Note:** The Environment-Friendly Use Period (EFUP) is not meant to be interpreted as the period assuring functionality and product performance.

“中国 RoHS”是一个工业术语，一般用于描述中华人民共和国信息工业部（MII）针对控制电子信息产品（EIP）的污染所实行的法令。



电气电子产品  
有害物质  
限制使用标识

中国 RoHS 标识是根据“电器电子产品有害物质限制使用管理办法”以及“电子电气产品有害物质限制使用标识要求”的规定，适用于在中国销售的电气电子产品上的电气电子产品有害物质限制使用标识。

注意：电气电子产品有害物质限制使用标识内的数字为在正常的使用条件下有害物质不会泄漏的年限，不是保证产品功能性的年限。

产品中有害物质的名称及含量

部件名称		有害物质					
		铅及其化合物 (Pb)	汞及其化合物 (Hg)	镉及其化合物 (Cd)	六价铬及其化合物 (Cr(VI))	多溴联苯 (PBB)	多溴二苯醚 (PBDE)
主体	机构部件	×	○	○	○	○	○
	光学部件	×	○	○	○	○	○
	电气部件	×	○	○	○	○	○
附件		×	○	○	○	○	○
<p>本表格依据 SJ/T 11364 的规定编制。</p> <p>○：表示该有害物质在该部件所有均质材料中的含量均在 GB/T26572 规定的限量要求以下。</p> <p>×：表示该有害物质至少在该部件的某一均质材料中的含量超出 GB/T26572 规定的限量要求。</p>							

## EMC Directive Compliance

This equipment generates and uses radio-frequency energy and, if not installed and used properly (that is, in strict accordance with the manufacturer's instructions), may cause interference. The 38DL PLUS has been tested and found to comply with the limits for an industrial device in accordance with the specifications of the EMC directive.

## FCC (USA) Compliance

This device complies with Part 15 of the FCC Rules. Operation is subject to the following two conditions:

1. This device may not cause harmful interference.
2. This device must accept any interference received, including interference that may cause undesired operation.

Changes or modifications not expressly approved by the party responsible for compliance could void the user's authority to operate the equipment.

This equipment has been tested and found to comply with the limits for a Class A digital device, pursuant to Part 15 of the FCC Rules. These limits are designed to provide reasonable protection against harmful interference when the equipment is

operated in a commercial environment. This equipment generates, uses, and can radiate radio frequency energy, and if not installed and used in accordance with the instruction manual, might cause harmful interference to radio communications. Operation of this equipment in a residential area is likely to cause harmful interference, in which case you will be required to correct the interference at your own expense.

## ICES-001 (Canada) Compliance

This Class A digital apparatus complies with Canadian ICES-001.

Cet appareil numérique de la classe A est conforme à la norme NMB-001 du Canada.

## Regulatory Information

The 38DL PLUS may display a regulatory screen that lists the specific regulation with which it complies.

### To view the REGULATORY screen

1. In the measurement screen, press **[2nd F]**, **[SETUP MENU]** (**SP MENU**).
2. In the **SP MENU**, select **REGULATORY** to display the **REGULATORY** screen.
3. Use the up and down arrow keys to scroll through the different **REGULATORY** screens.
4. Press **[MEAS]** to return to the measurement screen.

## Warranty Information

Olympus guarantees your Olympus product to be free from defects in materials and workmanship for a specific period, and in accordance with conditions specified in the *Olympus Scientific Solutions Americas Inc. Terms and Conditions* available at <http://www.olympus-ims.com/en/terms/>.

The Olympus warranty only covers equipment that has been used in a proper manner, as described in this instruction manual, and that has not been subjected to excessive abuse, attempted unauthorized repair, or modification.

Inspect materials thoroughly on receipt for evidence of external or internal damage that might have occurred during shipment. Immediately notify the carrier making the delivery of any damage, because the carrier is normally liable for damage during shipment. Retain packing materials, waybills, and other shipping documentation needed in order to file a damage claim. After notifying the carrier, contact Olympus for assistance with the damage claim and equipment replacement, if necessary.

This instruction manual explains the proper operation of your Olympus product. The information contained herein is intended solely as a teaching aid, and shall not be used in any particular application without independent testing and/or verification by the operator or the supervisor. Such independent verification of procedures becomes increasingly important as the criticality of the application increases. For this reason, Olympus makes no warranty, expressed or implied, that the techniques, examples, or procedures described herein are consistent with industry standards, nor that they meet the requirements of any particular application.

Olympus reserves the right to modify any product without incurring the responsibility for modifying previously manufactured products.

## **Technical Support**

Olympus is firmly committed to providing the highest level of customer service and product support. If you experience any difficulties when using our product, or if it fails to operate as described in the documentation, first consult the user's manual, and then, if you are still in need of assistance, contact our After-Sales Service. To locate the nearest service center, visit the Service Centers page at: <http://www.olympus-ims.com>.



---

## Introduction

---

This manual provides basic operating instructions for the 38DL PLUS ultrasonic thickness gage. The information in this manual is organized to explain the technology, safety details, hardware, and software. Practical measurement examples help the user become familiar with the instrument's capabilities.

---

### IMPORTANT

For advanced instructions on instrument configuration, use, troubleshooting, and maintenance, refer to the *38DL PLUS User's Manual*. The list of other 38DL PLUS documents is provided in "Instruction Manual" on page 5.

---



**Figure i-3 The 38DL PLUS instrument**



---

# 1. Instrument Description

---

This chapter describes the main features and the hardware components of the 38DL PLUS instrument.

---

<b>IMPORTANT</b>
------------------

The *38DL PLUS Ultrasonic Thickness Gage — User's Manual* (P/N: DMTA-10004-01EN) contains the information found in the present document as well as other sections describing the more advanced features of the instrument such as using special transducers, managing custom transducer setups, using software options, using the datalogger, and communicating with external devices.

You can find the PDF file of the *38DL PLUS Ultrasonic Thickness Gage — User's Manual* (P/N: DMTA-10004-01EN) on the GageView CD (P/N: Gageview [U8147006]) that is included with the 38DL PLUS kit.

---

## 1.1 Product Description

The 38DL PLUS by Olympus is a hand-held ultrasonic thickness gage designed for a wide variety of thickness measurement applications. With the 38DL PLUS, you only need access to one side of a part to measure, in a nondestructive manner, the thickness of corroded, pitted, scaled, granular, and other difficult materials (see Figure 1-1 on page 20).



**Figure 1-1 Measuring thicknesses with the 38DL PLUS**

The 38DL PLUS simultaneously displays a thickness readout and an A-scan view for waveform verification. The microprocessor of the 38DL PLUS continuously adjusts the receiver setup so that every measurement is optimized for reliability, range, sensitivity, and accuracy. An advanced internal datalogger can store up to 475000 thickness measurements and 20000 waveforms.

The 38DL PLUS operates with a full line of single element and dual element transducers to measure material thicknesses between 0.08 mm and 635 mm (0.003 in. and 25 in.). The temperature range of measured materials can be between  $-20\text{ }^{\circ}\text{C}$  and  $500\text{ }^{\circ}\text{C}$  ( $-4\text{ }^{\circ}\text{F}$  and  $932\text{ }^{\circ}\text{F}$ ) depending on the material characteristics, the transducer, and the measurement mode. You can also use single element or dual element transducers for echo-to-echo measurements.

You can connect the 38DL PLUS to a printer and to a computer using the bidirectional serial USB/RS-232 communication ports.

### **Advanced Measurement Features**

- THRU-COAT measurement
- Temperature-compensated measurement
- Min/Average mode

- EMAT transducer capability
- Measurement-related status flags and alarms
- Full VGA color transfective LED back-lite display
- Automatic probe recognition for the standard D79X and MTD705 series transducers
- Dynamic default gain optimization
- V-path calibration to build custom V-path correction tables for any dual element transducer
- Warning against calibration doubling
- Calibration for unknown material sound velocity and/or transducer zero
- Echo-to-echo measurements
- Fast scan mode with 30 readings per second
- Manual gain adjustment in 1-dB steps
- Hold or blank thickness display during loss-of-signal (LOS) conditions
- Hold minimum, maximum, or both minimum and maximum functions
- Differential thickness display relative to the set point in absolute or percentage ratio
- Selection of password-protected lockout functions
- Selectable resolution: low of 0.1 mm (0.01 in.), standard of 0.01 mm (0.001 in.), or high (optional) of 0.001 mm (0.0001 in.) [option not available for all transducers]

### **A-Scan and B-Scan Display Options**

- Real-time A-scan waveform display for verification of critical measurements
- Manual freeze mode with post processing
- Manual zoom and range control of waveform display
- Auto hold on LOS and auto zoom (measured echo centering)
- Extended blank
- Blank after first received echo in echo-to-echo mode
- Receiver gain readout
- Ability to capture and display waveform associated with minimum thickness during scanned measurements
- Display stored and downloaded waveforms

## Internal Datalogger Functions

- Internal data storage and possibility to export data to a removable microSD memory card
- Capacity to store 475000 fully-documented thickness readings or 20000 waveforms with thickness readings
- Database enhancements include 32-character file naming and 20-character ID naming
- Automatic ID number increments following a preset sequence, or manual ID numbering using the keypad
- Save reading/waveform to an ID number
- Simultaneously show ID number, stored comments, and stored reference thickness while displaying active thickness and waveform
- Nine file formats available
- Erase selected data or all stored data
- Save or send an held or frozen reading to the thickness display
- Transmit selected data or all stored data
- Keypad-programmable communication parameters
- Standard USB and RS-232 directional communication

## 1.2 Environmental Ratings

The 38DL PLUS is a rugged and durable instrument that you may use in harsh environments. The 38DL PLUS was designed to meet the requirement of the IP67 standard (Ingress Protection).




## CAUTION

Olympus cannot guarantee any level of ingress protection performance once the instrument seals have been manipulated. You must use sound judgment and take proper precautions before exposing the instrument to harsh environments.

To maintain the original level of ingress protection, you are responsible for the proper care of all routinely exposed membrane seals. Additionally, you are responsible for returning the instrument to an authorized Olympus service center each year to ensure that the instrument seals are properly maintained.

## 1.3 Instrument Hardware Components


The 38DL PLUS front panel features a color display and a keypad. The instrument comes with a hand strap. A protective rubber boot includes a dust flap seal for the DC power and serial communication connectors, strap rings at the four corners, and a stand at the back (see Figure 1-2 on page 23).

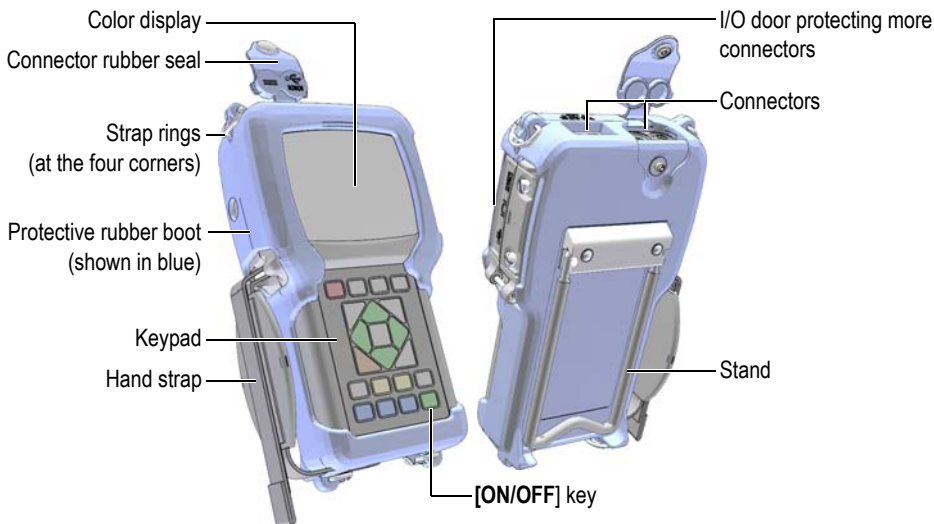

**Figure 1-2 The 38DL PLUS hardware components**

## 1.4 Connectors

Figure 1-3 on page 24 illustrates the possible connections of the 38DL PLUS with external devices.

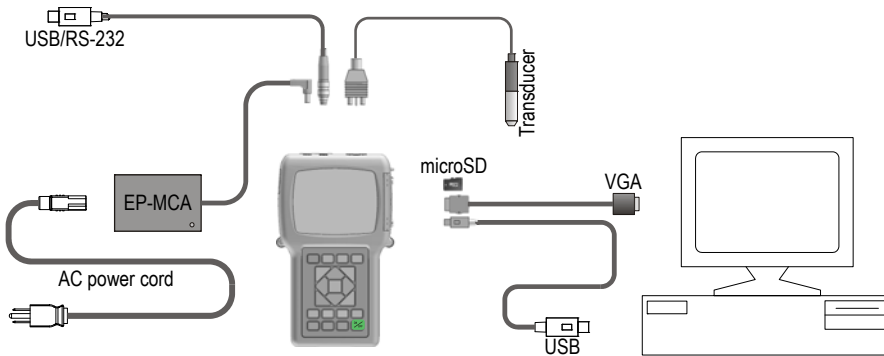

**Figure 1-3 The 38DL PLUS connections**




### **CAUTION**

To avoid the risk of injuries or equipment damage, use only the AC power cord supplied with the 38DL PLUS. Do not use this AC power cord with other products.


---

The DC power, USB/RS-232 communication, and Transmit/Receive probe connectors are located on the top end of the 38DL PLUS (see Figure 1-4 on page 25).

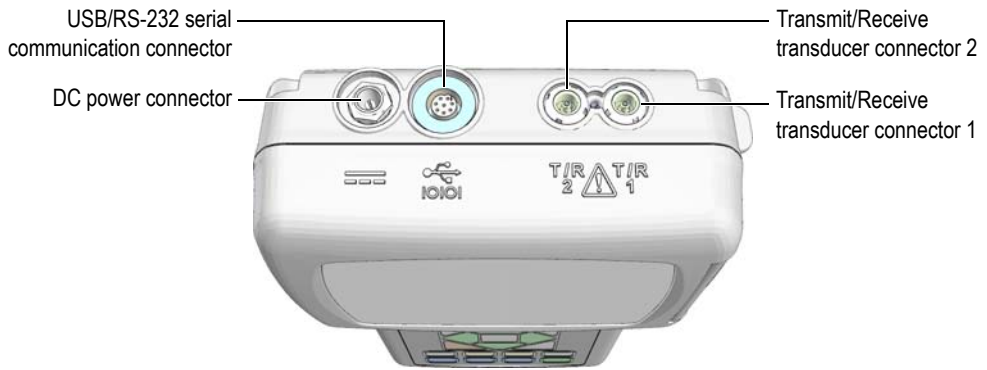

**Figure 1-4 The top end connectors**

The USB client connector, the VGA output connector, and the external microSD memory card slot are located on the right side of the instrument, hidden behind the I/O door (see Figure 1-5 on page 25).

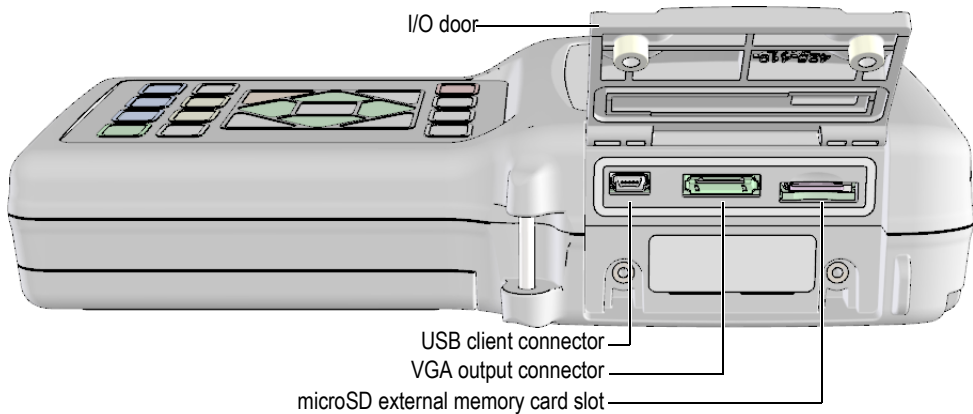

**Figure 1-5 The connectors behind the I/O door**

## 1.5 Keypad Functions

The 38DL PLUS comes either with the English, international, Chinese, or Japanese keypad (see Figure 1-6 on page 26). The functions are the same for all keypads. On the international keypad, the text labels on many keys are replaced by pictograms. In this document, keypad keys are referred to using the English label in bold and within brackets (ex.: [MEAS]).

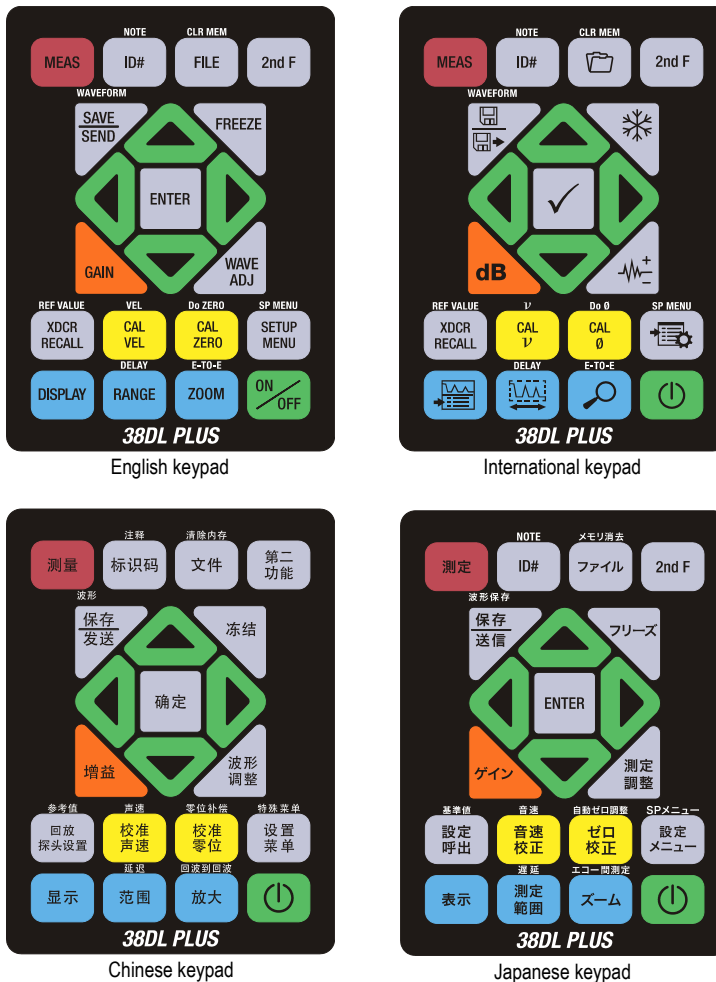


Figure 1-6 The 38DL PLUS keypads

Each key indicates its primary function. The area just above some of the keys indicates a secondary key function that you can activate by first pressing **[2nd F]**. Throughout this document, references to a secondary function are written as follows: **[2nd F], [Primary] (Secondary)**. For example, the instruction to activate the clear memory function is written as follows: “Press **[2nd F], [FILE] (CLR MEM)**”.

The **[▲]**, **[▼]**, **[◀]**, and **[▶]** keys, together with the **[ENTER]** key, are used to select menu items or screen parameters and to change parameter values. Use the **[MEAS]** key at any time to return to the measurement screen. The yellow keys are related to calibration. The blue keys are related to the display configuration.

Table 2 on page 27 lists the key functions available from the 38DL PLUS keypad.

**Table 2 Keypad functions**












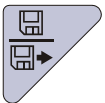
English	International	Functions
		Measurement — Completes the current operation and returns to the measurement screen.
		Identification number — Accesses several functions related to the ID numbers for the thickness measurement location.
 		Note — Allows you to create or select comments to store at an ID number location.
		File — Opens the file menu to access file commands (open, review, create, copy, edit, delete, send, import, export, note-copy, memory, and report).
 		Clear memory — Acts as an alternative method to erase an entire file. Also erases a range of data in a file or a single ID number location.
		Secondary function — Needs to be pressed prior to a key to activate the secondary function of the key.
		Save or send — Stores a measurement and optionally the corresponding waveform in the datalogger at the current ID number.

Table 2 Keypad functions (continued)













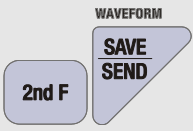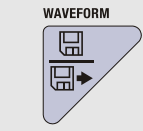


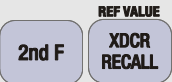







 



















English	International	Functions
		Save waveform — Stores a measurement and the corresponding waveform in the datalogger at the current ID number.
		Freeze — Causes the displayed waveform to immediately hold until the key is pressed again.
		Gain — Initiates the adjustment of the gain value when using dual element transducers.
		Wave adjustment — Toggles the display of a selectable waveform parameter with an editable value.
		Enter — Selects an highlighted item or accepts an entered value.
		Up arrow <ul style="list-style-type: none"> <li>In a screen or a list, moves to the previous element.</li> <li>For some parameters (ex.: <b>Gain</b>), increases the value.</li> </ul>
		Down arrow <ul style="list-style-type: none"> <li>In a screen or a list, moves to the next element.</li> <li>For some parameters (ex.: <b>Gain</b>), decreases the value.</li> </ul>
		Left arrow <ul style="list-style-type: none"> <li>Selects the previous available value for the selected parameter.</li> <li>In text edit mode, moves the cursor one character position to the left.</li> </ul>

Table 2 Keypad functions (*continued*)

English	International	Functions
		<p>Right arrow</p> <ul style="list-style-type: none"> <li>• Selects the next available value for the selected parameter.</li> <li>• In text edit mode, moves the cursor one character position to the right.</li> </ul>
		<p>Transducer recall — Recalls default or custom transducer (XDCR) setups.</p>
		<p>Reference value — For some functions (ex.: differential mode or temperature compensation) opens a screen allowing you to enter a reference value.</p>
		<p>Velocity calibration</p> <ul style="list-style-type: none"> <li>• Switches to the semi-automatic step block calibration mode.</li> <li>• When using THRU-COAT mode, press [CAL VEL] twice to view and set the coating velocity.</li> <li>• With the traditional text edit mode only, deletes the character at the cursor position.</li> </ul>
		<p>Velocity</p> <ul style="list-style-type: none"> <li>• Opens a screen allowing you to view and manually change the sound velocity.</li> <li>• In THRU-COAT mode or with the internal oxide option, pressing the keys a second time allows you to view/adjust the velocity for the coating or the oxide layer.</li> </ul>
		<p>Zero calibration</p> <ul style="list-style-type: none"> <li>• Compensates for transducer zero or enables the step block zero calibration.</li> <li>• With the traditional text edit mode only, inserts a character at the cursor position.</li> </ul>
		<p>Do zero — Compensates for transducer delay for dual element transducers and for the M2008 transducer.</p>

**Table 2 Keypad functions (continued)**

English	International	Functions
		Setup menu — Provides access to instrument parameters (measurement, system, alarm, differential mode, communication, B-scan, DB grid, avg/min, temperature correction, multilayer [optional], oxide [optional], password set, instrument lock).
 		Special menu — Provides access to special gage parameters (clock, language, options, resets, tests, software diagnostics, instrument status).
		Display — Provides access to display parameters (color scheme, brightness, waveform rectification, waveform trace, and VGA output).
		Range — Changes the waveform display range to the next available value.
 		Delay — Allows editing the value for the beginning of the waveform display.
		Zoom — Dynamically changes the waveform display range so that the region immediately surrounding the measured echo is shown at maximum magnification.
 		Echo-to-Echo — With dual element transducers, opens a menu to select the measurement mode (standard, auto echo-to-echo, or manual echo-to-echo).
		On/Off — Turns the instrument power on or off.

## 2. Powering the 38DL PLUS

This chapter describes how to operate the 38DL PLUS using different power supply options.

### 2.1 Power Indicator

The power indicator is always present on the right side of the screen. It shows the level of the battery charge and on which type of power the instrument operates (see Figure 2-1 on page 31).

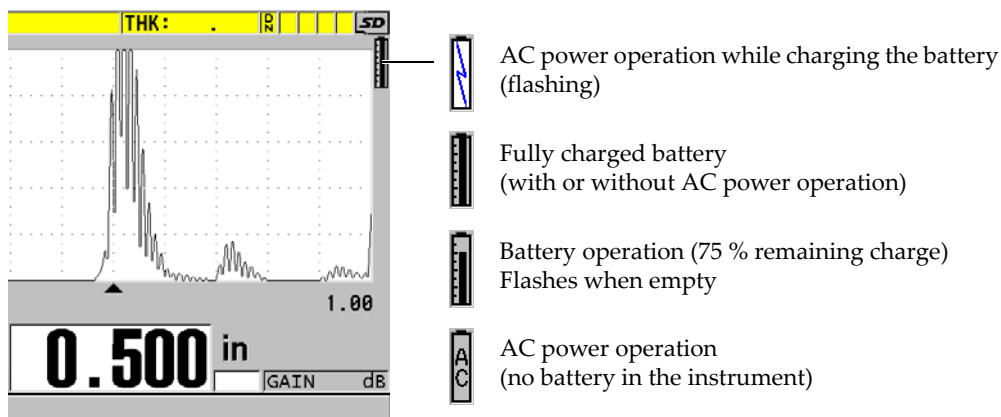


Figure 2-1 The power indicator for battery and AC operation

When the instrument operates on the battery, the vertical black bar in the power indicator indicates the remaining battery charge. Each graduation mark represents 12.5 % of the charge.

## 2.2 Using the AC Power

You can operate the 38DL PLUS with the AC power using the charger/adaptor (P/N: EP-MCA [U8767042]). The EP-MCA has a universal AC power input that operates with any line voltage from 100 VAC to 120 VAC or 200 VAC to 240 VAC and with 50 Hz to 60 Hz line frequency.

### To use AC power


1. Connect the AC power cord to the charger/adaptor (P/N: EP-MCA [U8767042]), and to an appropriate power outlet (see Figure 2-2 on page 32).



### CAUTION


To avoid the risk of injuries or equipment damage, use only the AC power cord supplied with the 38DL PLUS. Do not use this AC power cord with other products.

---

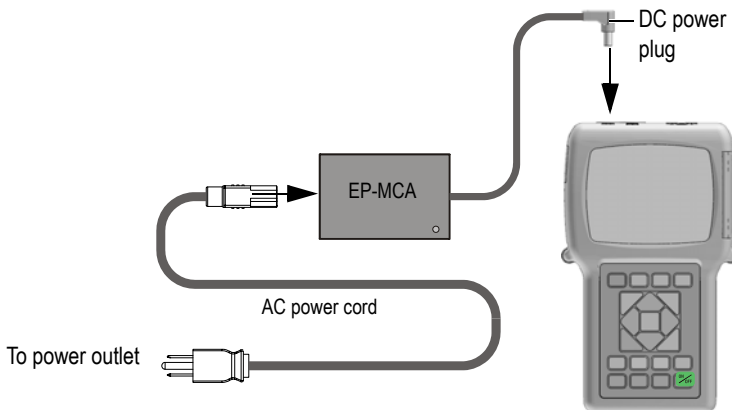

**Figure 2-2 Connecting the charger/adaptor**

2. On the 38DL PLUS, lift the rubber seal covering the DC adaptor connector on top of the 38DL PLUS (see Figure 2-3 on page 33).

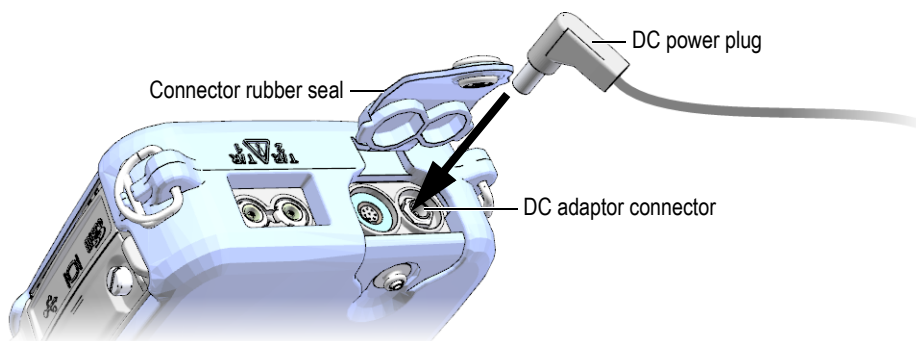

**Figure 2-3 Connecting the DC power plug**

3. Connect the DC power plug from the charger/adaptor to the DC adaptor connector (see Figure 2-3 on page 33).
4. Press [ON/OFF] to turn on the 38DL PLUS.

## 2.3 Using Battery Power

The 38DL PLUS comes with a rechargeable lithium-ion (Li-ion) battery (P/N: 38-BAT [U8760054]). The 38DL PLUS automatically recharges the 38-BAT battery when you connect the instrument to the AC power.

You can also operate the 38DL PLUS using four AA-size Alkaline or nickel metal hydride (NiMH) rechargeable batteries using the AA battery holder (P/N: 38DLP/AA [U8780290]). The 38DL PLUS does not recharge NiMH batteries. You must recharge AA batteries with an external battery charger (not included).

---

### NOTE

The 38DL PLUS battery is not fully charged when shipped. You must fully charge the battery before operating the instrument from the battery power.

---

## 2.3.1 Battery Operating Time

The battery operating time depends on the type of battery being used, the age of the battery, and the instrument settings. To provide realistic battery operating times, the 38DL PLUS has been tested with mid-level operating parameters (update rate set to 4 Hz and display brightness set to 50 %).

The nominal battery operating times for new batteries are:

- Rechargeable Li-ion: 12 to 14 hours
- AA NiMH: 4 to 5 hours (externally recharged)
- AA Alkaline: 2 to 3 hours (nonrechargeable)

## 2.3.2 Charging the Battery



### WARNING

The 38DL PLUS charger/adaptor (P/N: EP-MCA [U8767042]) is designed to charge 38DL PLUS batteries only (P/N: 38-BAT [U8760054]). Do not attempt to charge any other battery types (such as alkaline or NiMH) or use any other chargers/adaptors to charge the 38DL PLUS batteries (P/N: 38-BAT [U8760054]). Doing so may cause an explosion and injury.

---

---



### WARNING

Do not attempt to power or charge other electronic equipment with the 38DL PLUS charger/adaptor (P/N: EP-MCA [U8767042]) as this may cause death or serious personal injury as the result of the explosion while charging a battery.

---

### To charge the internal battery

- ◆ Connect the 38DL PLUS using the AC power (see “Using the AC Power” on page 32).  
The battery charges when the instrument is ON or OFF, but the rate of charge is slower when the instrument is ON.

**NOTE**

When the battery is fully charged, the battery charging symbol (lightning bolt) is replaced with a “full battery” symbol (battery with all bars full). This is the indication that the battery is fully charged (see “Power Indicator” on page 31). It takes approximately 2 to 3 hours to fully charge a battery depending on its initial conditions.

---

**NOTE**

It may take several cycles of complete charging and discharging of the battery to bring the battery to full capacity. This conditioning process is normal for this type of rechargeable batteries.

---

**Battery Usage Instructions**


- If the battery is used daily (or frequently), connect the instrument to the charger/adaptor when not in use.
- Whenever possible, the instrument should remain connected to the EP-MCA charger/adaptor (overnight or over a weekend), so that the battery reaches a full charge.
- The battery must reach full charge on a regular basis for proper capacity and cycle-life maintenance.
- Fully recharge discharged batteries as soon as possible after use.

**Battery Storage Instructions**

- Never store discharged batteries without a full recharge.
- Store batteries in a cool, dry environment.
- Avoid long-term storage under sunlight or in other excessively hot places such as the trunk of an automobile.
- While in storage, fully recharge batteries at least once every two (2) months.

### 2.3.3 Replacing the Battery

The battery is located in a compartment that is accessible from the back of the 38DL PLUS (see Figure 2-4 on page 36).

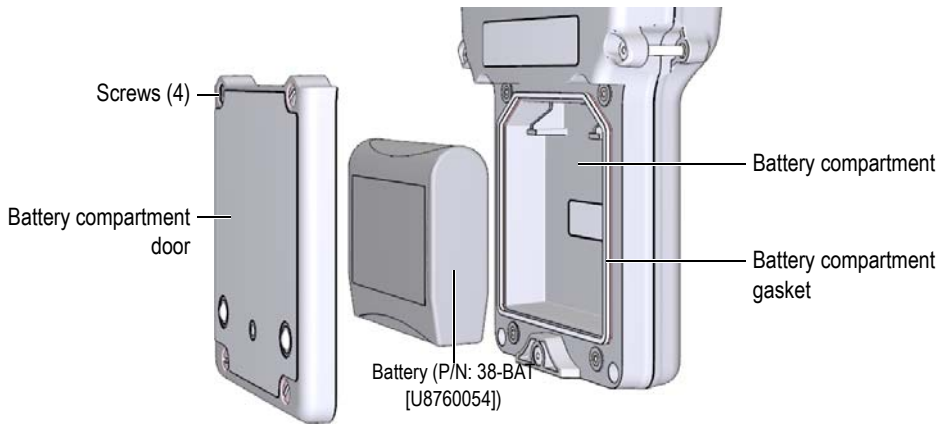

**Figure 2-4 Opening the battery compartment**



#### **CAUTION**

Do not attempt to replace the battery while the instrument is ON and/or connected to charger/adaptor. Dispose of used battery promptly. Keep away from children. The battery used in this device may present a risk of fire or chemical burn if mishandled. Do not disassemble, heat above 50 °C, or incinerate the battery. Replace the battery only with an Olympus battery (P/N: 38-BAT [U8760054]).

---

#### **To replace the battery**

1. Disconnect the instrument from the charger/adaptor.
2. Ensure that the 38DL PLUS power is off.
3. Disconnect any other cable connected to the 38DL PLUS.
4. Remove the hand strap.
5. Remove the protective rubber boot.

6. At the back of the instrument, unscrew the four screws of the battery compartment cover (see Figure 2-4 on page 36).
7. Remove the battery compartment cover.
8. Remove the battery and carefully disconnect the battery connector.
9. Connect the new battery in the battery compartment.
10. Ensure that the gasket of the battery compartment cover is clean and in good condition.
11. Reinstall the battery compartment cover at the back of the instrument, and then tighten the four screws.
12. Reinstall the protective rubber boot and the hand strap.
13. Press [ON/OFF] to turn on the 38DL PLUS.
14. To answer the question appearing at the bottom of the screen (see Figure 2-5 on page 37):
  - ◆ Select **Li-ion** when using a 38-BAT battery.

OR

Select **NiMH** or **Alkaline** when using four NiMH AA batteries or four Alkaline AA batteries with the AA battery holder.



**Figure 2-5 Selecting the new battery type**

**NOTE**

When replacing the rechargeable 38-BAT battery, fully charge the battery to ensure the accuracy of the estimated remaining battery charge shown by the power indicator (see "Power Indicator" on page 31).



### 3. Software User Interface Elements

The following sections describe the main elements of the 38DL PLUS software screens and menus.

#### 3.1 Measurement Screen

The 38DL PLUS starts with the measurement screen where you can see the ultrasonic echo on the waveform display and read the measured thickness value (see Figure 3-1 on page 39). The measurement screen is the main screen of the 38DL PLUS software. From anywhere in the 38DL PLUS software, simply press [MEAS] to return to the measurement screen. The power indicator is always present on the right side of the 38DL PLUS screen (see “Using Battery Power” on page 33 for details).


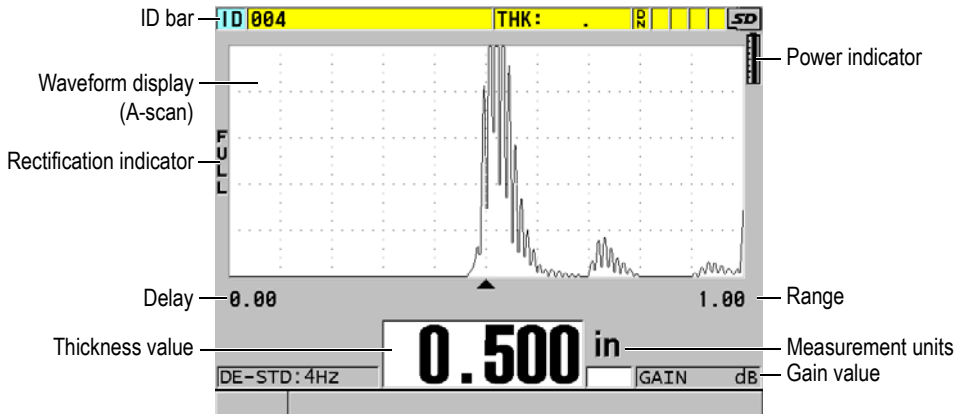


Figure 3-1 The main elements of the measurement screen

The waveform trace, called the A-scan, allows a skilled operator to verify that the signal used to make a thickness measurement is the correct back-wall echo and not noise, material anomaly, or the second multiple echo. The A-scan can also allow you to observe indications that may be too small to be measured by the instrument.

The ID bar, located at the top of the measurement screen, contains the ID for the actual thickness measurement location, the previously stored value, and comment notes indicators (see Figure 3-2 on page 40). The download indicator (R) appears when the previously stored thickness measurement comes from a file rather than from a newly acquired value.

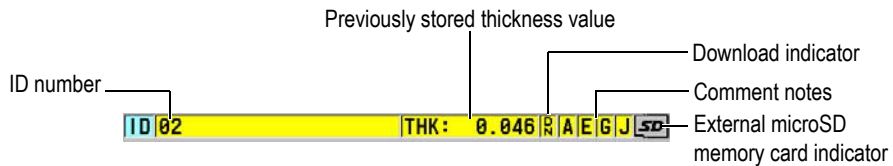

**Figure 3-2 The ID bar**

The external microSD memory card indicator appears in the top-right corner of the screen when a microSD memory card is inserted in its slot under the I/O door on the right side of the instrument (see Figure 1-5 on page 25). The 38DL PLUS recognizes an external microSD memory card when you start the instrument.

Depending on the context and on the available functions and options, various indicators and numeric values appear around the waveform display and around the main measurement value (see Figure 3-3 on page 41). A help text bar, at the bottom of the screen, indicates the keys that you can use to navigate and make a selection in the menu structure.

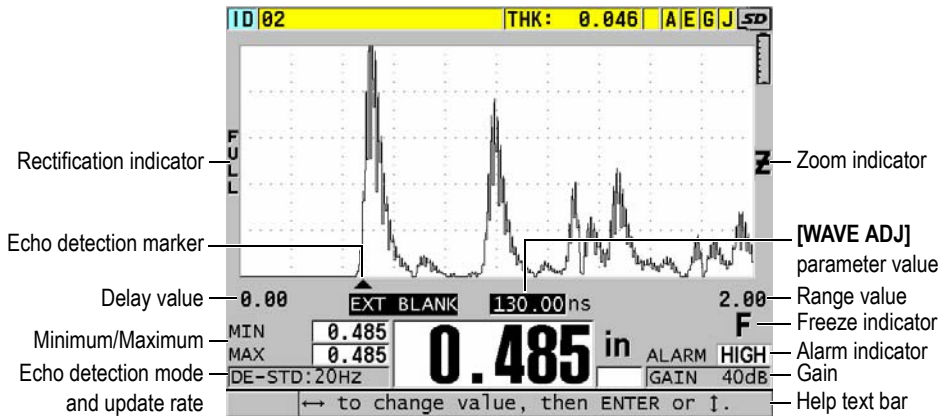


Figure 3-3 Example of other elements appearing on the measurement screen

The loss-of-signal (LOS) appears and the thickness value is cleared when the 38DL PLUS no longer detects ultrasonic echoes (see Figure 3-4 on page 41).

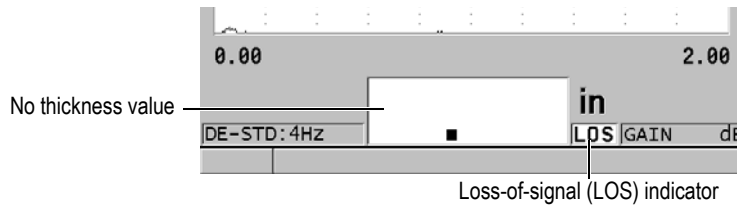


Figure 3-4 The loss-of-signal (LOS) indicator

## 3.2 Menus and Submenus

The 38DL PLUS displays menus and submenus when you press some of the front panel keys. The menu appears at the top-left corner of the screen (see Figure 3-5 on page 42). If applicable, a submenu also appears, conveniently showing the parameters available for the highlighted menu command.

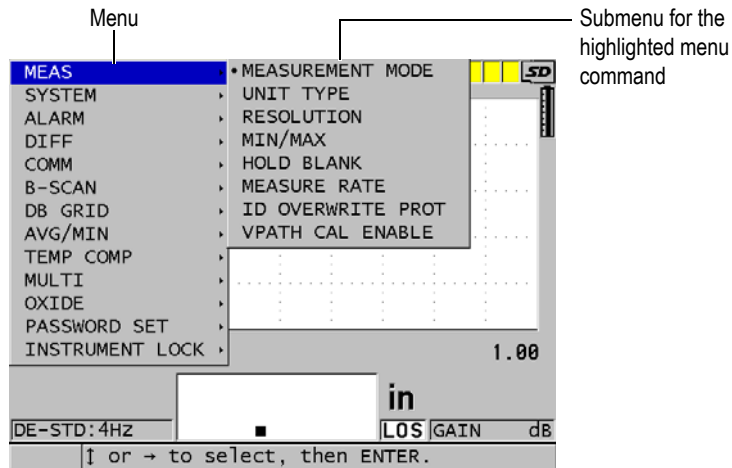


Figure 3-5 Menu and submenu example

### To select a menu or a submenu command

1. Press one of the front panel keys to display a menu.
2. Use the [▲] and [▼] keys to highlight the desired menu command.
3. If applicable and needed, use the [▶] key to move the highlight to the submenu, and then use the [▲] and [▼] keys to highlight the desired submenu command.
4. Press [ENTER] to select the highlighted menu, or submenu command.

#### NOTE

In the remainder of this document, the above procedure is summarized by simply stating to select a specific menu or submenu command. For example: “In the menu, select **MEAS**.”

## 3.3 Parameter Screens

The 38DL PLUS parameters are logically grouped in parameter screens that you access using front panel keys or menu commands. Figure 3-6 on page 43 shows the **MEAS** parameter screen as an example.

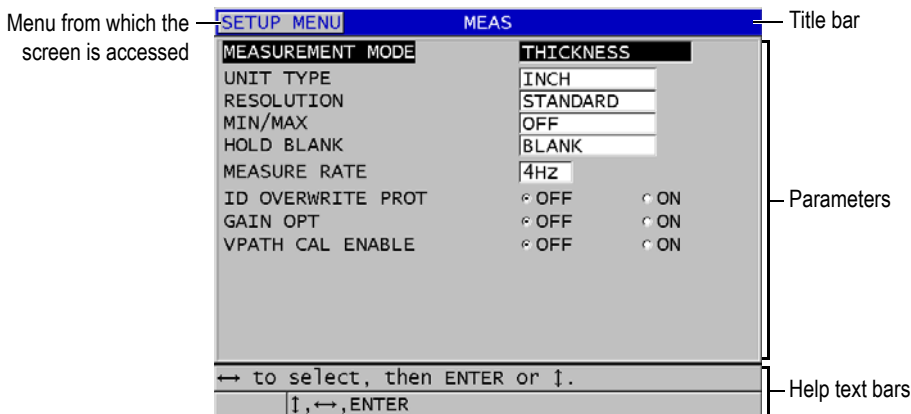


Figure 3-6 Parameter screen example

The title bar, located at the top of the parameter screen, indicates the parameter subject. When you access a parameter screen from a menu, a menu button appears on the left side of the title bar. You can select this menu button to easily return to the original menu. One or two help text bars, appearing at the bottom of the screen, indicate the keys to use to select a parameter and edit its value.

### To select a parameter and edit its value

1. Use the [▲] and [▼] keys to highlight the desired parameter.
2. For parameters with predefined values, use the [▶] and [◀] keys to select the desired value.
3. In parameter screens containing lists or alphanumeric parameters:
  - In a list, use the [▲] and [▼] keys to highlight the desired list item.
  - For an alphanumeric parameter, use the [▲] and [▼] keys to enter the desired characters (see “Selecting the Text Edit Mode” on page 44 for details).
  - Press [2nd F], [▼] or [2nd F], [▲] to leave a list or an alphanumeric parameter, and respectively go to the next or previous screen element.
4. To exit the parameter screen:
  - ◆ Press [MEAS] to return to the measurement screen.
  - OR
  - When a menu button appears in the left corner of the title bar, use the [▲] key to highlight the menu button, and then press [ENTER] to reopen the menu.

---

<b>NOTE</b>
-------------

In the remainder of this document, the above procedure is summarized by simply stating to select a specific parameter or list, and its value. For example:  
“In the **MEAS** screen, set **MEASUREMENT MODE** to **THICKNESS**.”

---

## 3.4 Selecting the Text Edit Mode

The 38DL PLUS offers two methods to edit the value of alphanumeric parameters. You can either use the virtual keyboard or the traditional method. The virtual keyboard appears on the screen to show all the available characters that you can use (see “Editing Text Parameters Using the Virtual Keyboard” on page 44 for details). With the traditional method, you select each character from a hidden list of standard sorted letters, numbers, and special characters (see “Editing Text Parameters Using the Traditional Method” on page 46 for details).

### To select the text edit mode

1. From the measurement screen, press [SETUP MENU].
2. In the menu, select **SYSTEM**.
3. In the **SYSTEM** parameter screen, highlight **TEXT EDIT MODE**, and then select the desired mode (**VIRTUAL** or **TRADITIONAL**).
4. Press [MEAS] to return to the measurement screen.

### 3.4.1 Editing Text Parameters Using the Virtual Keyboard

When the text edit mode is set to **VIRTUAL**, the virtual keyboard appears when you select an alphanumeric parameter (see Figure 3-7 on page 45).

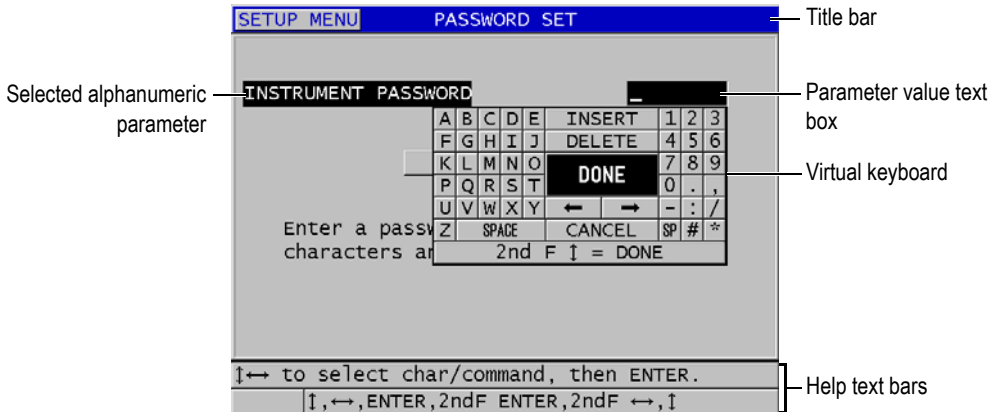


Figure 3-7 Example of the virtual keyboard

### To edit an alphanumeric parameter value using the virtual keyboard

1. Select an alphanumeric parameter.  
The virtual keyboard appears.
2. Use the [▲], [▼], [▶], and [◀] keys to highlight the character that you wish to enter, and then press [ENTER].  
The selected character appears in the parameter value text box and the cursor moves to the next character position.
3. Repeat the previous step to enter other characters.
4. If you need to move the position of the cursor in the value text box, on the virtual keyboard, highlight either the left or right arrow button (below **DONE**), and then press [ENTER].  
The cursor moves by one character position.
5. When you need to delete a character:
  - a) Move the cursor to the character you wish to delete.
  - b) On the virtual keyboard, highlight **DELETE**, and then press [ENTER].
6. When you need to insert a character:
  - a) Move the cursor to the character in front of which you wish to insert a character.
  - b) On the virtual keyboard, highlight **INSERT**, and then press [ENTER].
  - c) Enter the desired character in the inserted space.

7. If you want to cancel the editing operation and return to the original parameter value, on the virtual keyboard, highlight **CANCEL**, and then press **[ENTER]**.
8. To complete the editing of the parameter value, on the virtual keyboard, highlight **DONE**, and then press **[ENTER]**.

---


**NOTE**

When editing a multiple line parameter value, highlighting **DONE** and pressing **[ENTER]** moves the cursor to the next line. You can also press **[2nd F]**, **[▼]** to accept the text and move the cursor to the next line.

---

### 3.4.2 Editing Text Parameters Using the Traditional Method

When the text edit mode is set to **TRADITIONAL**, you select each character from a hidden circular list of standard sorted letters, numbers, and special characters (see Figure 3-8 on page 46). Only upper case letters are available.

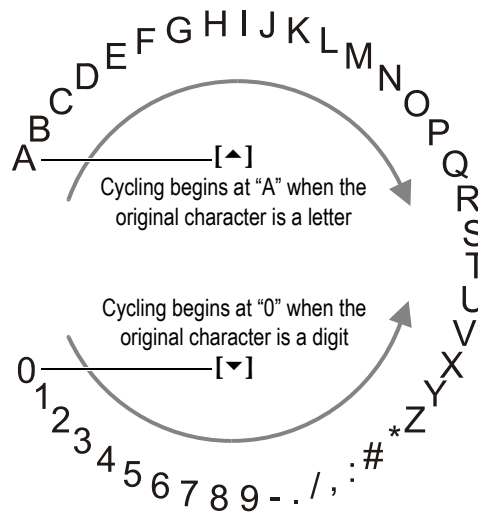

**Figure 3-8 The character cycle of the traditional text edit method**

## To edit an alphanumeric parameter value using the traditional method

1. Select an alphanumeric parameter.
2. Use the [▲] and [▼] keys to select the character that you wish to enter. Hold down the key to quickly cycle through the letters, numbers, and special characters.
3. Use the [▶] keys to move to the next character.
4. Repeat the steps 2 and 3 to enter other characters.
5. If you need to move the position of the cursor in the value text box, use the [▶] or [◀] key.
6. To insert a character at the cursor position, press [CAL ZERO].  
The character at the cursor and all those to the right moves one position to the right, making a space for a new character.
7. To delete the character at the cursor position, press [CAL VEL].  
The character at the cursor is deleted and any characters to the right move to the left by one position.
8. Press [ENTER] to accept the character string and move to the next parameter.



---

## 4. Initial Setup

---

The following sections describe basic system configurations.

### 4.1 Setting the User Interface Language and Other System Options

You can configure the 38DL PLUS to present the user interface in the following languages: English, German, French, Spanish, Japanese, Chinese, Russian, Swedish, Italian, Norwegian, Portuguese, Czech, and a customized interface. You can also set the character delimiting the radix of a number.

The 38DL PLUS includes a beep tone generator to confirm when a key is pressed and to notify you of an alarm condition. You can set the beeper on or off.

To save battery while you do not use the instrument, you can enable the inactive time function so that the instrument automatically turns off when no key has been pressed and no measurement has been made within about six minutes.

#### To change the user interface language and other system options

1. Press [SETUP MENU].
2. In the menu, select **SYSTEM**.
3. In the **SYSTEM** screen (see Figure 4-1 on page 50):
  - a) Set **BEEPER** to **ON** or **OFF**.
  - b) Set **INACTIVE TIME** to **ON** or **OFF**.
  - c) Set **LANGUAGE** to the desired language.
  - d) Set **RADIX TYPE** to the desired character (period or comma) to separate the integer and the decimal digits.

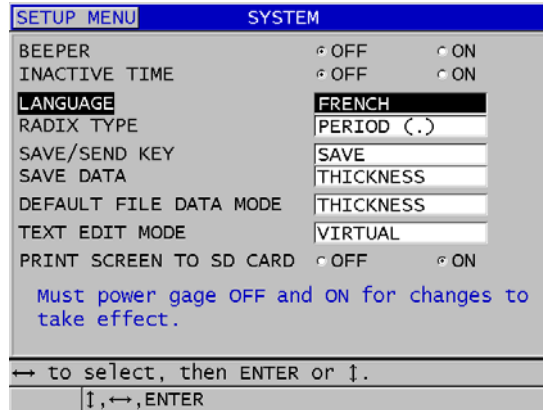


Figure 4-1 Selecting the user interface language

4. Press **[MEAS]** to return to the measurement screen.
5. Turn off the 38DL PLUS, and then turn it back on to activate the language change.

## 4.2 Selecting the Measurement Units

You can set the 38DL PLUS to show thickness measurements in inches or millimeters.

### To set the measurement units

1. Press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **UNIT TYPE** to **INCH** or **MILLIMETER**.
4. Press **[MEAS]** to return to the measurement screen.

## 4.3 Setting the Clock

The 38DL PLUS has a built-in date and time clock. You can set the date and the time and select their format. The 38DL PLUS saves all measurements value with their acquisition date.

## To set the clock

1. Press [2nd F], [SETUP MENU] (SP MENU).
2. In the menu, select **CLOCK**.
3. In the **CLOCK** screen (see Figure 4-2 on page 51):
  - a) Set parameters to the current date and time and to the desired date and hour modes.
  - b) Select **SET**.

The screenshot shows a menu titled 'SP MENU' on the left and 'CLOCK' on the right. The main area contains the following settings:

MONTH	2
DAY	24
YEAR	2010
DATE MODE	MM/DD/YYYY
HOUR	2 PM
MINUTE	35
HOUR MODE	12 HOUR

At the bottom of the screen, there are two buttons: 'SET' and 'CANCEL'. Below the buttons, there is a help text: '↔ to change value, then ENTER or ↓.' and a key indicator '↑, ↔, ENTER'.

Figure 4-2 Selecting clock parameters


## 4.4 Changing Display Settings

You can change the appearance of some display elements such as colors, brightness, waveform rectification, and waveform trace.

### To change the display setting

1. From the measurement screen, press [DISPLAY].
2. In the **DISPLAY SETTINGS** screen (see Figure 4-3 on page 52), select the desired parameter and value for the following parameters:
  - **COLOR SCHEME** to either select the **INDOOR** or **OUTDOOR** optimized visibility (see “Color Schemes” on page 52 for details).

- **DISPLAY BRIGHTNESS** to select one of the predefined brightness levels (see “Display Brightness” on page 53 for details).
- **WAVEFORM RECTIFICATION** to select one of the rectification modes (see “Waveform Rectification” on page 54 for details).
- **WAVEFORM TRACE** to select one of the trace types (see “Waveform Trace” on page 55 for details).
- **VGA OUTPUT** to turn **ON** or **OFF**, the VGA signal for the VGA output (see “Using the VGA Output” on page 86 for details).

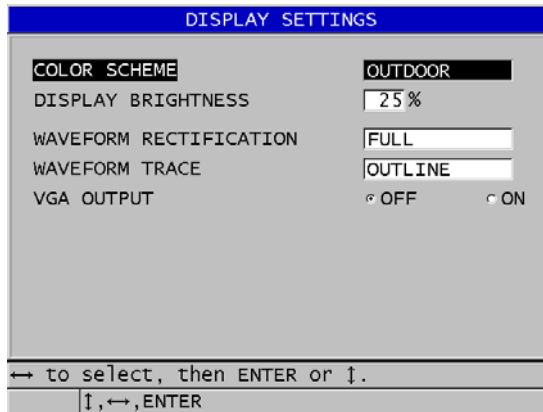


**Figure 4-3** The **DISPLAY SETTINGS** screen

3. Press **[MEAS]** to return to the measurement screen.

#### 4.4.1 Color Schemes

The 38DL PLUS offers two standard color schemes designed to provide best display visibility in indoor or outdoor lighting conditions (see Figure 4-4 on page 53). From the measurement screen, press **[DISPLAY]** to access the **COLOR SCHEME** parameter.

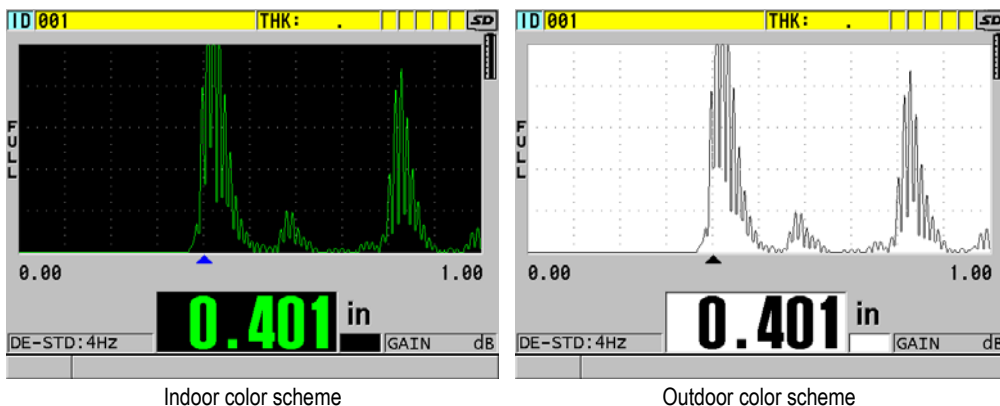

**Figure 4-4 Example of the indoor and the outdoor color schemes**

The indoor scheme gives the best visibility when you use the instrument indoors or in low lighting conditions. The indoor scheme presents green characters and waveform trace on a black background.

The outdoor scheme gives best visibility when you use the instrument in direct sunlight. The outdoor mode presents black characters and waveform trace on a white background. For best readability, in this document, most screen captures are shown with the outdoor color scheme.

#### NOTE

Colored measurement values corresponding to specific alarm conditions only appear when the indoor color scheme is selected.

## 4.4.2 Display Brightness

You can adjust the 38DL PLUS display brightness by selecting the backlight intensity. The display brightness can be set at 0 %, 25 %, 50 %, 75 %, and 100 %. Choosing a high percentage increases the brightness of the display. By default, the display brightness is set to 25 %. From the measurement screen, press **[DISPLAY]** to access the **DISPLAY BRIGHTNESS** parameter.

The 38DL PLUS uses a transfective color display that reflects ambient light and becomes brighter in direct light. With brighter ambient conditions, you can set the display brightness to a lower percentage.

**NOTE**

Reducing the display brightness percentage increases the battery life. Battery life specifications are based on backlight brightness set to 50 %.

### 4.4.3 Waveform Rectification

The rectification mode is the way in which the ultrasonic echoes are represented on the waveform display (see Figure 4-5 on page 54). The rectification mode does not affect the thickness measurement in any way. The rectification indicator (**FULL**, **POS**, **NEG**, or **RF**) appears on the left edge of the waveform display. From the measurement screen, press **[DISPLAY]** to access the **WAVEFORM RECTIFICATION** parameter.

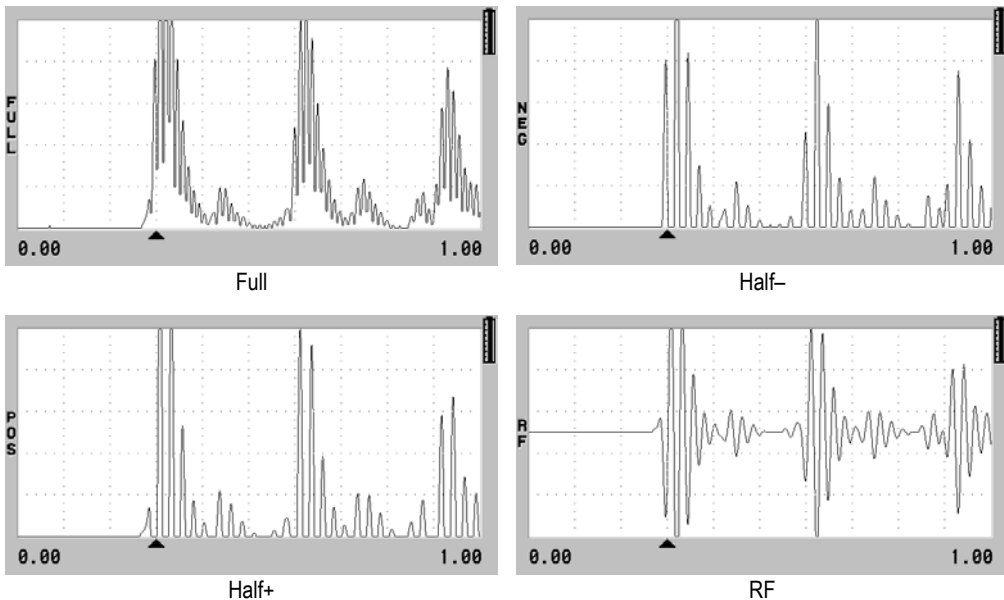


Figure 4-5 Examples of the rectification modes

The available rectification modes are:

**FULL**

Shows the negative portion of the echo folded around the baseline so that both positive and negative waveform lobes are displayed. Gives the best overall representation of position and magnitude for most thickness measurement applications. **FULL** is the default mode for dual element transducers.

**HALF-** (NEG indicator)

Shows negative waveform lobes as positive and does not show the positive lobes.

**HALF+** (POS indicator)

Shows positive waveform lobes and does not show the negative waveform lobes.

**RF**

Shows negative and positive lobes on either side of the baseline. **RF** is the default mode for single element transducers.

#### 4.4.4 Waveform Trace

The 38DL PLUS can display the waveform trace as a line (**OUTLINE**) or as a **FILLED** area (see Figure 4-6 on page 56). From the measurement screen, press **[DISPLAY]** to access the **WAVEFORM TRACE** parameter.

---

<b>NOTE</b>
-------------

A filled waveform trace is only possible when the waveform rectification is set to **FULL**, **HALF+**, or **HALF-**.

---

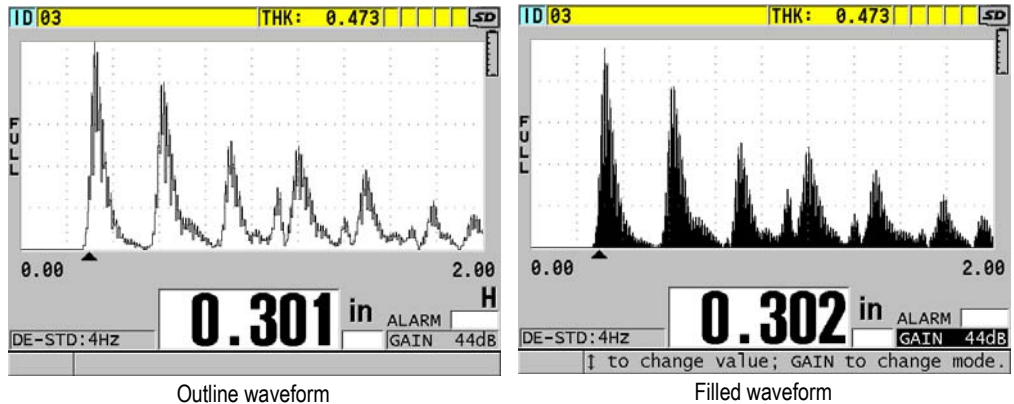


Figure 4-6 Examples of waveform trace modes

## 4.5 Range of the Waveform Display

The range of the waveform display is the distance spanned by the horizontal axis of the waveform display. The left end of the horizontal axis, the delay, is generally set to zero. You can manually adjust the delay value to change the starting point of the range (see “Adjusting the Delay Value” on page 58) and select the end point of the range (see “Selecting the Range Value” on page 57). You can also activate the zoom function to automatically set the delay and the range values to best see the echo (see “Activating the Zoom Function” on page 58).

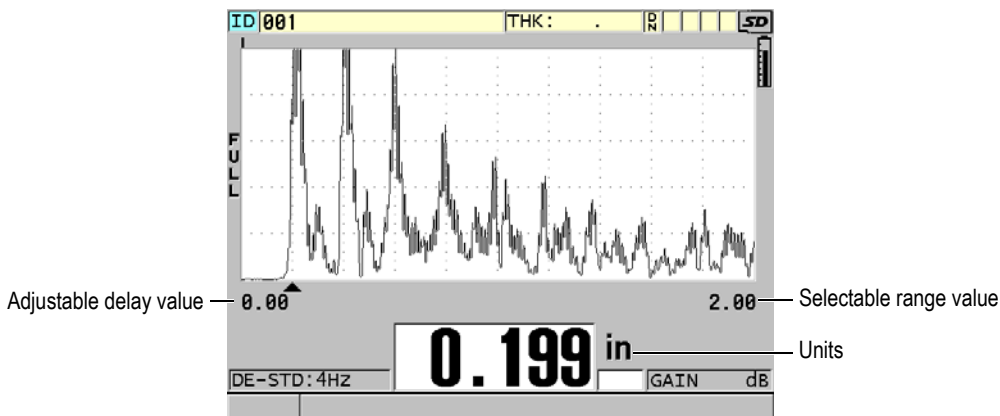


Figure 4-7 The range of the waveform display

#### 4.5.1 Selecting the Range Value

There are fixed ranges available for each transducer frequency. The available ranges are also dependent on material sound velocity. These selectable ranges let you adjust the thickness span of the waveform display to only show the thickness range being measured and thus, obtain maximum waveform resolution for each application. The range setting affects the waveform display only. You can still make measurements even when the display range does not show the detected echo from which the thickness is measured. You cannot manually set the range while the zoom is active.

##### To select the range value

1. From the measurement screen, press **[RANGE]**.  
The waveform range changes to the next higher available range.
2. Continue to press **[RANGE]** until you obtain the desired range.  
The range value recycles to the minimum range value following the maximum value.

## 4.5.2 Adjusting the Delay Value

The delay of the waveform display adjusts the beginning of the horizontal span. You can adjust the delay to display the waveform of interest in the center of the waveform display. This function is very useful when using delay line or immersion transducers, or when measuring thick material so that the measured echoes can be seen in greater detail.

### To adjust the delay value

1. Press **[2nd F]**, **[RANGE]** (**DELAY**).
2. Use the arrow keys to adjust the delay value.
3. Press **[2nd F]**, **[RANGE]** (**DELAY**) again to stop editing the delay value.

---

<b>TIP</b>
------------

Press and hold the **[RANGE]** key to reset the delay to zero.

---

## 4.5.3 Activating the Zoom Function

The zoom function automatically and dynamically sets the delay and the range values to optimally track and show the detected echo in the waveform display.

### To activate the zoom function

1. From the measurement screen, press **[ZOOM]**.  
The zoom flag (**Z**) appears on the right side of the waveform display, below the power indicator.
2. Press **[ZOOM]** again to turn off the zoom function.

The resulting zoomed waveform depends on the current measurement mode. The zoom for D79X dual element transducers and mode 1 single element transducers centers the first back-wall echo on the screen (see Figure 4-8 on page 59).

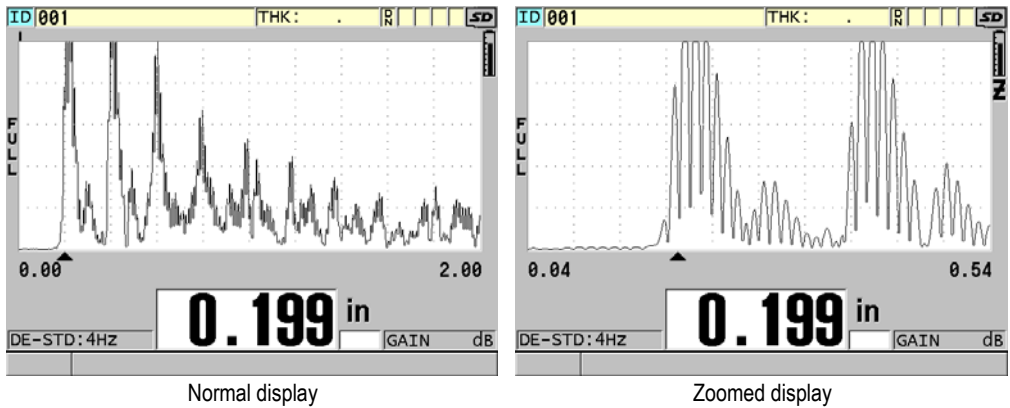


Figure 4-8 Comparing normal and zoomed display in mode 1

The zoom with single element transducers in mode 2 adjusts the waveform range and delay so that the interface echo and the first back-wall echo appear on the waveform display (see Figure 4-9 on page 59).



Figure 4-9 Comparing normal and zoomed display in mode 2

The zoom with single element transducers in mode 3 adjusts the waveform range and delay so that the interface echo and the second measured back-wall echo appear on the waveform display (see Figure 4-10 on page 60).

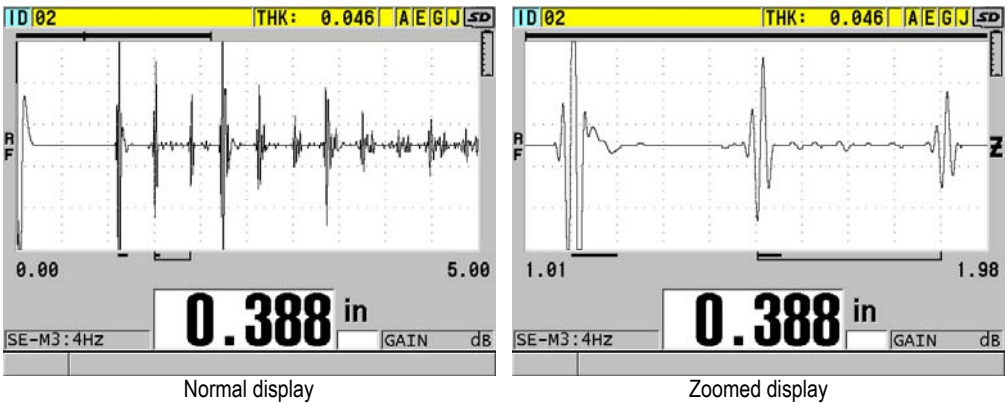


Figure 4-10 Comparing normal and zoomed display in mode 3

## 4.6 Adjusting the Measurement Update Rate

You can select a predefined measurement update rate (4 Hz, 8 Hz, 16 Hz, 20 Hz, or **MAX**). The measurement update rate indicator is always present on the left of the thickness measurement (see Figure 4-11 on page 60).



Figure 4-11 The measurement update rate indicator

The **MAX** update rate is up to 30 Hz and is dependent on measurement type. This option is useful when making high temperature thickness measurements to help limit the transducer contact time or for applications where you scan the transducer over an area to find the minimum thickness.

**NOTE**

The 38DL PLUS automatically uses the fastest update rate when entering the **Minimum** or **Maximum** mode.

---

**To adjust the measurement update rate**

1. From the measurement screen, press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set the **MEASURE RATE** to the desired value.
4. Press **[MEAS]** to return to the measurement screen.

## 4.7 Changing the Thickness Resolution

You can change the thickness measurement resolution, meaning the number of digits shown to the right of the decimal point. The resolution selection affects all displays and data output of values with thickness units. This includes measured thickness, differential reference value, and alarm set points. The highest thickness resolution with dual element transducer is 0.01 mm (0.001 in.). The velocity is always reported with full four-digit resolution.

You can reduce the resolution in some applications where the extra precision of the last digit is not required, or where extremely rough outside or inside surfaces make the last thickness display digit unreliable.

The high resolution software option (P/N: 38DLP-HR [U8147015]) allows to increase the resolution to 0.001 mm (0.0001 in.). The high resolution is available for measured thickness smaller than 102 mm (4 in.). The high resolution is not active with low-frequency transducers and when the high penetration software option is activated.

**To change the thickness measurement resolution**

1. Press **[SETUP MENU]**.
2. In the menu, select **MEAS**.
3. In the **MEAS** screen, set **RESOLUTION** to the desired option:
  - **STANDARD**: 0.01 mm or 0.001 in. (default)
  - **LOW**: 0.1 mm or 0.01 in.

- Optional **HIGH**: 0.001 mm or 0.0001 in.
4. Press [**MEAS**] to return to the measurement screen.

---

## 5. Basic Operation

---

The following sections describe the basic operation for the 38DL PLUS ultrasonic thickness gage.


### 5.1 Setting Up the Transducer

The 38DL PLUS operates with a full line of single element and dual element transducers. The 38DL PLUS automatically recognizes standard D79X dual element transducers and automatically loads the appropriate predefined setup. The predefined setup contains ultrasonic velocity for the stainless steel step block supplied with the instrument. With dual element transducers, you need to perform a transducer zero compensation.

For a single element transducer, or other dual element transducers, you need to manually load an appropriate setup. The 38DL PLUS ships from the factory set up with default conditions for the purchased transducers using an approximate sound velocity for the stainless steel test block provided with the instrument. The default conditions are selected to facilitate instrument usage for your applications.


#### To set up the transducer

1. Plug the transducer into the transducer connector(s) at the top of the 38DL PLUS case (see Figure 5-1 on page 64). Use T/R 1 for a single element transducer.

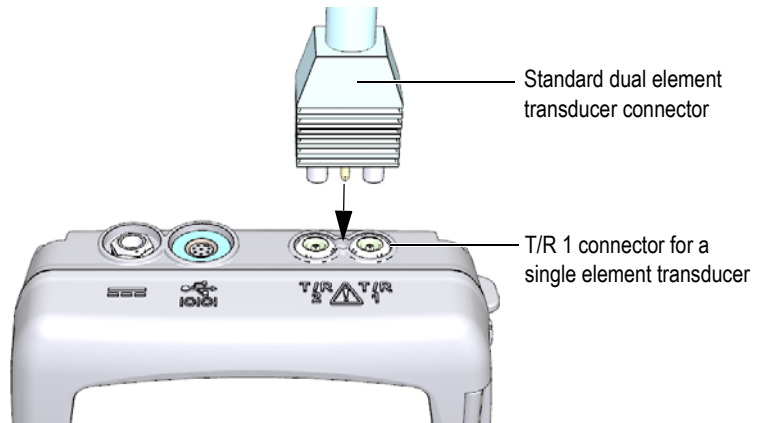

**Figure 5-1 Plugging the transducer**


2. Press [ON/OFF] to start the instrument. The measurement screen appears. With a standard D79X dual element transducer, the “Do--” message appears in the measurement screen (see Figure 5-2 on page 64).

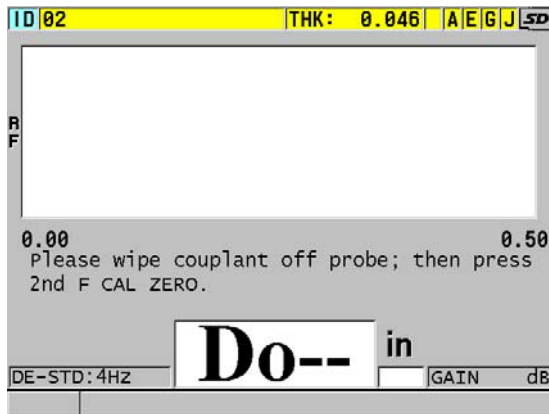


**Figure 5-2 Initial screen with a standard D79X dual element transducer**

3. For dual element transducers, perform the transducer zero compensation:
  - a) Wipe couplant off the tip of the transducer.

- b) Press **[2nd F]**, **[CAL ZERO]** (**Do ZERO**).
  4. For a single element transducer, or other dual element transducers, load an appropriate setup:
    - a) Press **[XDCR RECALL]**.
    - b) In the menu, select the default choice for the probe type that you use (ex.: **DEFAULT SINGLE ELEMENT**).
    - c) In the **DEFAULT** screen for the type of probe that you are using (see the example shown in Figure 5-3 on page 65), in the list of available default setups, highlight the setup for the transducer that you are using.

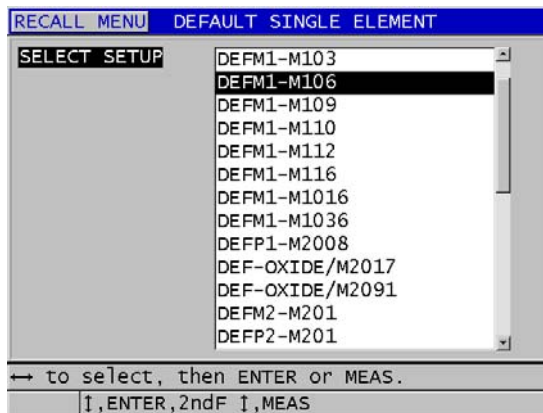

**Default setup naming convention:**

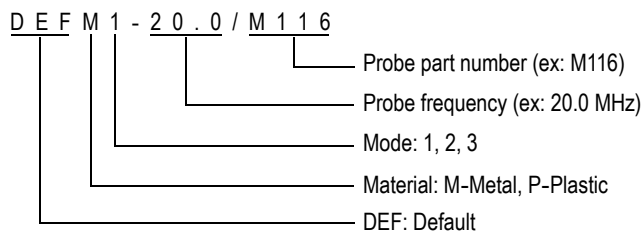

**Figure 5-3 Selecting a default single element transducer setup**

**NOTE**

You can rename the setups listed as USER-1 through USER-35 for special applications.

---

- d) Press **[MEAS]** to automatically recall the setup parameters for the chosen setup and return to the measurement screen.

## 5.2 Calibration

The calibration is the process of adjusting the instrument to accurately measure on a particular material, using a known transducer at a given temperature. Calibrating the instrument is always necessary before inspecting a specific material. The measurement accuracy is only as good as the calibration that you perform.

You need to perform the following three calibration types:

### Transducer zero compensation (**[Do ZERO]**)

For dual element transducer only, calibrate for the sound transit time in each of the dual transducer delay lines. This compensation varies in each transducer unit and with temperature. You must perform the transducer zero compensation procedure when the unit is powered on, when the transducer is changed, and when the transducer temperature changes significantly (see “Setting Up the Transducer” on page 63 and “Transducer Zero Compensation” on page 70).

### Material sound velocity calibration (**[CAL VEL]**)

Perform a velocity calibration using a thick test block of the measured material with known thickness or by manually entering a previously determined material sound velocity. You must perform this procedure for each new measured material (see “Calibrating the Instrument” on page 67 and “Material Sound Velocity and the Zero Calibrations” on page 71).

### Zero Calibration (**[CAL ZERO]**)

Perform a zero calibration using a thin test block of the measured material with known thickness. Unlike the transducer zero compensation and the material sound velocity calibration, this procedure is not required unless you need the best absolute accuracy (better than  $\pm 0.10$  mm or  $\pm 0.004$  in.). You only need to do it once for each new transducer and material combination. You do not have to repeat the zero calibration when the transducer temperature changes; Transducer zero compensation is responsible for that task (see “Calibrating the Instrument” on page 67 and “Material Sound Velocity and the Zero Calibrations” on page 71).

## 5.2.1 Calibrating the Instrument

When you want to make accurate measurements, you need to perform the following calibrations:


- Material sound velocity calibration
- Zero calibration

You must perform the calibrations using a thick and a thin sample of precisely known thicknesses. The sample must be made of the same material as the parts to be inspected (see “Test Blocks” on page 70 for details on test blocks).

The following procedure is illustrated using a dual element probe and a 5-step test block. Refer to “Calibration” on page 66 for more details on the calibration process.

### To calibrate the instrument

1. To perform the material sound velocity calibration (see Figure 5-4 on page 68):
  - a) Place a drop of couplant on the surface of the thick part of the test block.
  - b) Couple the transducer to the thick part of the test block using moderate to firm pressure.  
The waveform and the thickness reading appear on the screen.
  - c) Press **[CAL VEL]**.
  - d) When the thickness reading is stable, press **[ENTER]**.
  - e) Using the arrow keys, edit the thickness value to match the known thick thickness of the test block.

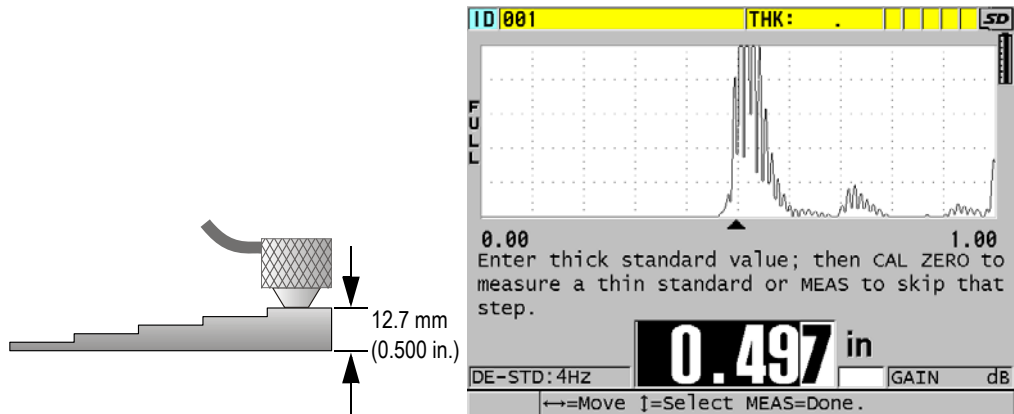

**Figure 5-4 Performing the material sound velocity calibration on a 5-step test block**

2. To perform the zero calibration (see Figure 5-5 on page 69):
  - a) Place a drop of couplant on the surface of the thin part of the test block.
  - b) Couple the transducer to the thin part of the test block, and then press **[CAL ZERO]**.
  - c) When the thickness reading is stable, press **[ENTER]**.
  - d) Using the arrow keys, edit the thickness value to match the known thin thickness of the test block.

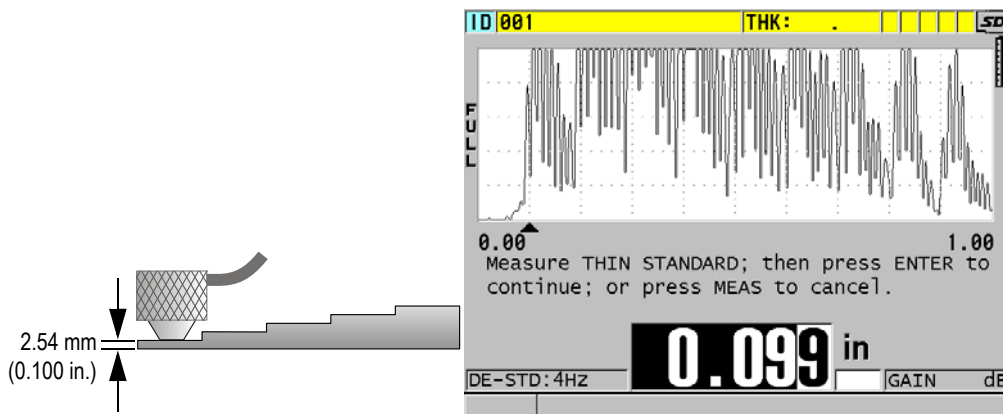


Figure 5-5 Performing the zero calibration on a 5-step test block

3. Press **[MEAS]** to complete the calibration and return to the measurement screen.

#### IMPORTANT

If you turn off the instrument before pressing **[MEAS]**, the velocity is not updated to the new value; instead the instrument retains the previous value.

#### NOTE

When the 38DL PLUS detects an error in the calibration procedure, it successively displays the following messages in the help text bar before returning to the measurement screen:

**“Potential wrong echo detected!”**

**“Invalid calibration results!”**

In this case, the velocity is not changed. The probable case is that an incorrect thickness value was entered.

## 5.2.2 Test Blocks

The 38DL PLUS comes with a cylindrical stainless steel test block with two thicknesses. You can use the two precisely known test block thicknesses to perform the material sound velocity and the zero calibrations.

Precision step test blocks are also often used when more than two known thicknesses are needed (see Figure 5-6 on page 70).



**Figure 5-6 Example of a 5-step test block**

When performing the material sound velocity and zero calibration, you must use a test block with the following characteristics:

- Made from the same material as the parts to be tested.
- Have two or more precisely known thicknesses
- Have one part as thin as the thinnest section of the parts to be tested to perform the zero calibration. The surface condition should be similar to that of the tested parts. Rough surfaces generally reduce the accuracy of measurements, but simulating actual surface conditions on the calibration block can help to improve results.
- Have one part as thick as the thickest section of the parts to be tested, to perform the material sound velocity calibration. The front and back surfaces should be smooth and parallel.
- Be at the same temperature as the samples to be measured.

## 5.2.3 Transducer Zero Compensation

Perform a transducer zero compensation by pressing **[2nd F]**, **[CAL ZERO]** (**Do ZERO**) whenever the message “**Do—**” or the zero indicator appear. You should also perform this procedure when the dual element transducer temperature has changed.

The frequency at which you perform a transducer zero compensation procedure depends on the rate of change of the internal temperature of the dual element transducer. This is related to the material surface temperature, frequency of transducer application, length of time the transducer is held in contact with the material, and the accuracy that you want to obtain.

---

<b>NOTE</b>
-------------

When measurements are made on surfaces that are significantly above room temperature, the zero should be recalibrated on a regular basis. This is less important for transducers part numbers D790-SM, D791-RM, D797-SM, and D798 than for other transducers that have various types of resin delay lines.

---

For high temperature measurements, Olympus recommends that you develop a transducer zero compensation schedule that takes these factors into account. For example, use the D790-SM, D791-RM, or D797-SM for high temperature applications, minimizing the frequency of the zero compensation. You can also use the D790-SM and D791-RM for general purpose applications.

## 5.2.4 Material Sound Velocity and the Zero Calibrations

The 38DL PLUS performs a material gain optimization during the velocity calibration procedure when this feature is activated.

For dual element transducers, the material gain optimization (**GAIN OPT** in the **MEAS** screen) evaluates the signal from the test block and automatically sets a starting default gain based on the transducer sensitivity and material noise levels. When the default gain required is outside of the allowable range, a message appears, specifying that the transducer may not be functioning correctly.

The 38DL PLUS performs a calibration doubling verification to help prevent mis-calibrating on thin samples. Doubling occurs when the instrument measures the time to the second back-wall echo rather than detecting the first back-wall echo. The 38DL PLUS compares the measured time of flight to the expected time of flight based on the current sound velocity. The 38DL PLUS displays a warning message if doubling is suspected. Doubling can occur when measuring a thickness that is below the minimum range of the transducer, or when a transducer is worn or low in sensitivity.

**NOTE**

You can also achieve a material sound velocity and zero calibration procedure by performing the operations in the reverse order, starting with the zero calibration, followed by the material sound velocity calibration.

---

## 5.2.5 Entering a Known Material Sound Velocity

When preparing to measure thicknesses on parts made of a different material, if you know the sound velocity for the material, you can directly enter the velocity without performing a material sound velocity calibration procedure.

### To enter a known material sound velocity

1. From the measurement screen, press [2nd F], [CAL VEL] (VEL).
2. In the **VELOCITY** screen (see Figure 5-7 on page 72), use the arrow keys to edit the velocity to the known value.

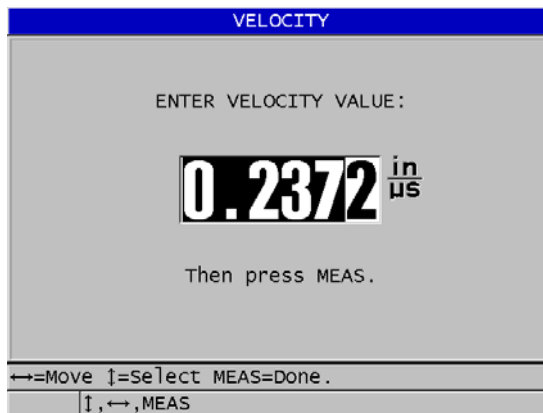


Figure 5-7 Entering a known material sound velocity

3. Press [MEAS] to return to the measurement screen.

## 5.2.6 Locked Calibrations

The 38DL PLUS includes a password-protected locking function to prevent changes to setups and prevent access to some functions. A change to the calibration is one action that you can lock. When this is the case, the message shown in Figure 5-8 on page 73 appears momentarily on the help text bar.



Figure 5-8 The calibration lock message

## 5.2.7 Factors Affecting the Performance and the Accuracy

The following factors affect the performance of the instrument and the accuracy of the thickness measurements.

### Calibration

The accuracy of any ultrasonic measurement is only as good as the accuracy and care with which you calibrate the instrument. The 38DL PLUS ships from the factory with standard setups for a number of transducers and applications. In some cases, it may be desirable to optimize these setups for specific measurement situations. In all cases, it is essential that you perform the velocity and zero calibrations whenever the test material or transducer is changed. Periodic checks with samples of known thickness are recommended to verify that the gage is operating properly.

### Surface roughness of the test piece

The best measurement accuracy is obtained when both the front and back surfaces of the test piece are smooth. When the contact surface is rough, the minimum thickness that can be measured will be increased because of sound reverberating in the increased thickness of the couplant layer. Additionally, when the two test piece surfaces are rough, the slightly different multiple sound paths seen by the transducer may cause distortion in the returning echo, resulting in measurement inaccuracies.

### Coupling technique

In mode 1 (contact transducer) measurements, the couplant layer thickness is part of the measurement and is compensated by a portion of the zero offset. If maximum accuracy is to be achieved, then the coupling technique must be

consistent. In order to accomplish consistent measurements, use a couplant of reasonably low viscosity; employ only enough couplant to achieve a reasonable reading; and apply the transducer with uniform pressure. Practice will show the degree of moderate to firm pressure that produces repeatable readings. In general, smaller diameter transducers require less coupling force to squeeze out the excess couplant than larger diameter transducers. In all modes, tilting the transducer distorts echoes and causes inaccurate readings, as noted below.

#### Curvature of the test piece

A related issue to this section involves the alignment of the transducer with respect to the test piece. When measuring on curved surfaces, it is important that the transducer be placed approximately on the centerline of the part and held as steadily to the surface as possible. In some cases, a spring-loaded V-block holder may be helpful for maintaining this alignment. In general, as the radius of curvature decreases, the size of the transducer should be reduced, and the more critical transducer alignment will become. For very small radii, an immersion approach is necessary. In some cases it may be useful to observe the waveform display as an aid in maintaining optimum alignment. Practice the best way to hold a transducer with the aid of a waveform display. On curved surfaces, it is important to use only enough couplant to obtain a reading. Excess couplant forms a fillet between the transducer and the test surface where sound reverberates and possibly creates spurious signals that may trigger false readings.

#### Taper or eccentricity

If the contact surface or back surface of the test piece is tapered or eccentric with respect to the other, the return echo is distorted due to the variation in sound path across the width of the beam. The accuracy of the measurement is reduced. In severe cases, no measurement is possible.

#### Acoustic properties of the test material

There are several conditions found in certain engineering materials that can potentially limit the accuracy and range of ultrasonic thickness measurements:

- Sound scattering:  
In materials such as cast stainless steel, cast iron, fiberglass, and composites, sound energy scatters from individual crystallites in the casting or boundaries of dissimilar materials within the fiberglass or composite. Porosity in any material can have the same effect. Adjust the instrument sensitivity to prevent detection of these spurious scatter echoes. This compensation can in turn limit the ability to discriminate a valid return echo from the back wall of the material, thereby restricting measurement range.
- Sound attenuation or absorption:  
In many organic materials such as low density plastics and rubbers, sound

energy is attenuated very rapidly at the frequencies used for ultrasonic gaging. This attenuation typically increases with temperature. The maximum thickness that can be measured in these materials will often be limited by attenuation.

— Velocity variations:

An ultrasonic thickness measurement is accurate only to the degree that material sound velocity is consistent with the instrument calibration. Some materials exhibit significant variations in sound velocity from point to point. This happens in certain cast metals due to the changes in grain structure that result from varied cooling rates, and the anisotropy of sound velocity with respect to grain structure. Fiberglass can show localized velocity variations due to changes in the resin/fiber ratio. Many plastics and rubbers show a rapid change in sound velocity with temperature, requiring that velocity calibration be performed at the temperature where measurements are made.

#### Phase reversal or phase distortion

The phase or polarity of a returning echo is determined by the relative acoustic impedances (density  $\times$  velocity) of the boundary materials. The 38DL PLUS assumes the customary situation where the test piece is backed by air or a liquid, both of which have a lower acoustic impedance than metals, ceramics, or plastics. However, in some specialized cases, such as measurement of glass or plastic liners over metal, or copper cladding over steel, this impedance relationship is reversed and the echo appears phase reversed. In these cases, it is necessary to change the appropriate echo detection polarity in order to maintain accuracy. A more complex situation can occur in anisotropic or inhomogeneous materials such as coarse-grain metal castings or certain composites, where material conditions result in the existence of multiple sound paths within the beam area. In these cases, phase distortion can create an echo that is neither cleanly positive nor negative. Careful experimentation with reference standards is necessary in these cases to determine effects on measurement accuracy.

## 5.3 Measuring Thicknesses

You can start measuring thicknesses once a transducer is connected (see “Setting Up the Transducer” on page 63) and once the instrument is calibrated (see “Calibrating the Instrument” on page 67).


### To measure thicknesses

1. Apply couplant to the test block or tested part at the measuring spot.

**NOTE**

In general, use a thinner couplant such as propylene glycol, glycerin, or water for smooth material surfaces. Rough surfaces require a more viscous couplant such as gel or grease. Special couplants are required for high temperature applications.

- Using moderate to firm pressure, couple the tip of the transducer to the surface of the test material, and keep the transducer as flat as possible on the material surface (see Figure 5-9 on page 76).

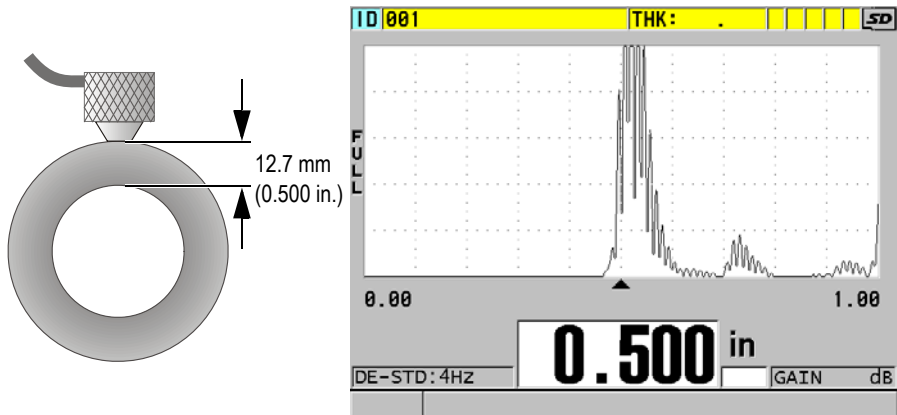


**Figure 5-9 Coupling dual element transducer and reading the measured thickness**

- Read the measured thickness value for the tested part.

## 5.4 Saving Data

The 38DL PLUS datalogger is a file based system where one file is opened at a time. The active file stores a measurement at a thickness measurement location ID. Each time you press [SAVE/SEND], the displayed value is saved to the active file at the current ID. The ID is automatically incremented for the next measurement. When you press [FILE], the name of the active file appears in the ID bar above the menu (see Figure 5-10 on page 77).

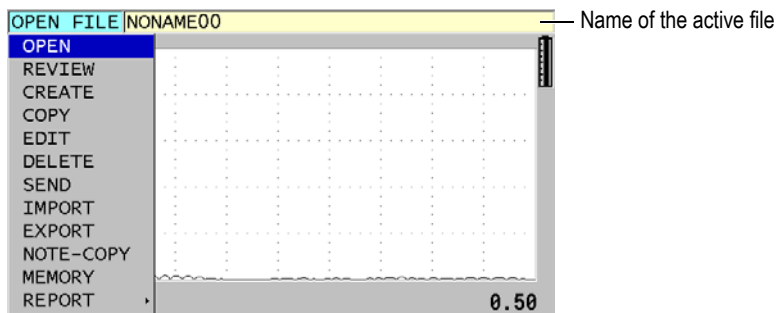

**Figure 5-10 The active file name appearing in the ID bar**

The NONAME00 increment type file, starting with the 001 ID, is the active file by default when you first use the 38DL PLUS or after resetting the instrument memory. You can create various types of files and define IDs to represent various 1-D, 2-D, or 3-D thickness measurement locations. When restarting, the instrument automatically opens the last file that was used.

The following special cases may occur:

- When the thickness value is blank, “— —” is saved rather than a value.
- When a measurement is already stored at the current ID, the new value overwrites the old thickness reading unless the overwrite protection is enabled.
- When the ID increment reaches the end of a sequence and cannot be updated, **Last ID** appears on the help text bar, a long beep sound is emitted (when the beeper is active), and the ID on the display remains unchanged.

#### To save data at the current ID in the active file

- ◆ While the desired thickness value and waveform are displayed, press [SAVE/SEND] to save the measured thickness value.  
OR  
Press [2nd F], [SAVE/SEND] (WAVEFORM) to save the measured thickness value and the waveform.

**TIP**

If you want to always save both the thickness and the waveform when you press [SAVE/SEND], in the SYSTEM screen, set SAVE DATA to THK+WF.

## 5.5 Measurements with THRU-COAT D7906 and D7908 Transducers

THRU-COAT is a function that measures the true metal thickness of coated or painted parts. This function only requires a single back-wall echo and is recommended for heavy corrosion applications where the outside of the material is coated or painted. If needed, you can also calibrate the measurement of the coating/paint layer to precisely measure the thickness of the coating/paint.

### 5.5.1 Enabling the THRU-COAT Function

The THRU-COAT function is only available when you connect a THRU-COAT transducer (P/N: D7906 [U8450005] or D7908 [U8450008]) to the 38DL PLUS.

#### To enable the THRU-COAT function

1. Connect a THRU-COAT transducer to the 38DL PLUS.
2. Start the instrument.
3. Wipe the couplant off the transducer tip.
4. Press [2nd F], [CAL ZERO] (Do ZERO).

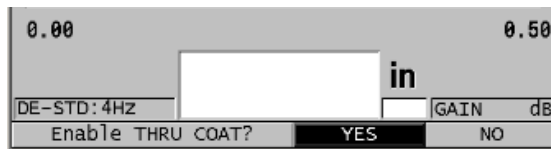


Figure 5-11 Opening the THRU COAT SETUP dialog box

5. Select **YES** to answer the **Enable THRU COAT?** prompt.

## 5.5.2 Performing a THRU-COAT Calibration

The calibration procedure for a THRU-COAT probe is similar to the procedure for other probes. As for a normal calibration, you need two uncoated samples with accurately known thin and thick thicknesses to perform the following calibration procedure. The difference is that towards the end of the procedure, you can press **[CAL VEL]** a second time to calibrate the coating thickness measurement on a sample with an accurately known coating thickness.

### To perform a THRU-COAT calibration

1. Ensure that the THRU-COAT function is enabled (see “Enabling the THRU-COAT Function” on page 78).
2. Couple the transducer to the thick sample.
3. Press **[CAL VEL]**.
4. When the reading is stable, press **[ENTER]**.
5. Using the arrow keys, edit the thickness value to match the known thickness of the sample.
6. Couple the transducer to the thin sample.
7. Press **[CAL ZERO]**.
8. When the reading is stable, press **[ENTER]**.
9. Using the arrow keys, edit the thickness value to match the known thickness of the sample.
10. If the coating thickness measurement accuracy is important for your application, perform the following actions (omitting this step does not affect the accuracy of the metal thickness measurement):
  - a) Press **[CAL VEL]** again.
  - b) Couple the transducer to the coated sample.
  - c) When the reading is stable, press **[ENTER]**.
  - d) Using the arrow keys, edit the thickness value to match the known coating thickness of the coated sample.
11. Press **[MEAS]** to complete the calibration.

**NOTE**

Pressing [2nd F], [CAL VEL] (VEL) opens the VELOCITY screen where you can see and edit the calibrated metal sound velocity. Pressing [2nd F], [CAL VEL] (VEL) again opens the VELOCITY screen for the calibrated sound velocity through the coating.

## 5.6 Echo Detection Modes with Dual Element Transducers

With dual element transducers, the 38DL PLUS offers three echo detection modes allowing you to measure thicknesses in various material conditions. A description of each of the three echo detection modes (STANDARD, AUTO E-TO-E, and MANUAL E-TO-E) follows:

### STANDARD

The standard echo detection mode measures the thickness based on the time of flight between the main bang to the first back-wall echo. Use this mode for uncoated materials with good echo waveforms.

The DE-STD indicator appears to the left of the thickness reading and a triangular echo detection marker appears at the back-wall echo below the waveform display (see Figure 5-12 on page 80).


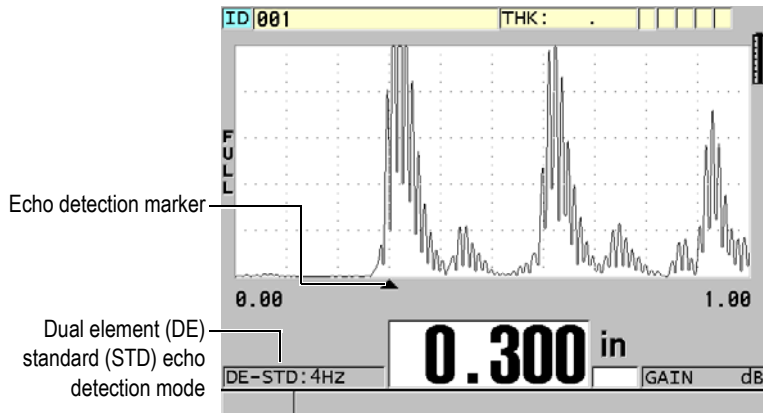


Figure 5-12 Measuring with the standard echo detection mode

## AUTO E-TO-E

The automatic echo-to-echo detection mode measures the thickness using the time of flight between two consecutive back-wall echoes. Use this mode for painted or coated materials since the time interval between consecutive back-wall echoes excludes the time of flight through a paint, resin, or coating layer. The **DE-AEtoE** indicator appears to the left of the thickness reading. The triangular marker is replaced by an echo-to-echo detection bar to indicate the exact pair of back-wall echoes used to determine the thickness (see Figure 5-13 on page 81). The echo height is automatically adjusted to a preset level.

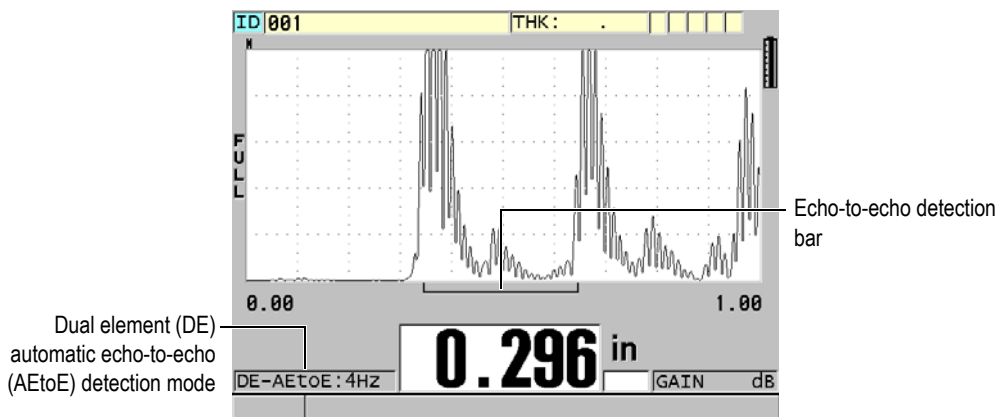


**Figure 5-13 Measuring with the automatic echo-to-echo detection mode**

## MANUAL E-TO-E

The manual echo-to-echo detection mode also measures the thickness using the time of flight between two consecutive back-wall echoes. In this mode, you can however also manually adjust the gain and the blanking parameters. Use this mode when material conditions produce noisy signals where the automatic mode may be less effective.

The **DE-MEtoE** indicator appears to the left of the thickness reading. The echo-to-echo detection bar is similar to the automatic echo-to-echo mode but includes the adjustable E1 blank bar that indicates the area to exclude for echo detection (see Figure 5-14 on page 82). Following the E1 blank, the instrument detects the next echo with an amplitude of at least 20 % of the waveform display height. In this mode, press **[WAVE ADJ]**, and then use the arrow keys to adjust the **EXT BLANK**, the **E1 BLANK**, and the **GAIN** parameters.

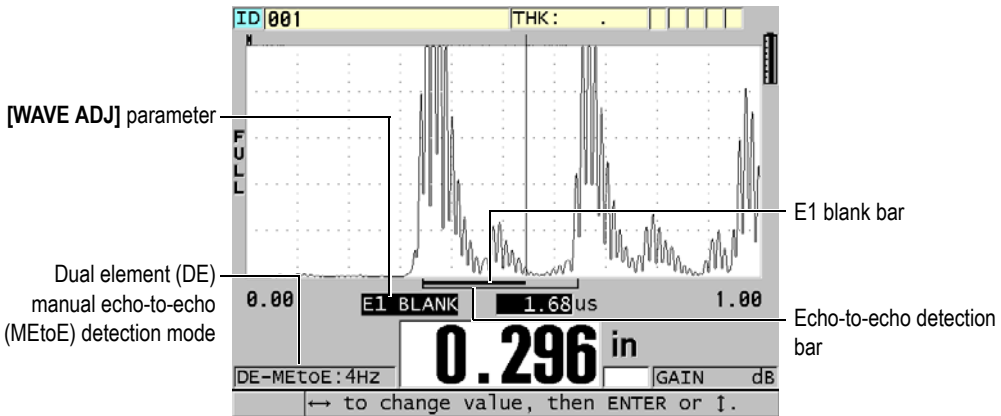

**Figure 5-14 Measuring with the manual echo-to-echo detection mode**

---

**NOTE**

In severe corrosion situations where valid multiple echoes are not present, you must use the standard mode to be able to measure thicknesses.

---

You can use dual element transducers in all three modes. You can use all measurement, display, and datalogger functions with the echo-to-echo modes. The internal datalogger recognizes and saves all necessary echo-to-echo information to upload and download thickness, waveform, and setup data.

---

**TIP**

You do not have to switch between echo detection modes when measuring both coated and uncoated areas because you can measure uncoated wall thicknesses using an echo-to-echo mode.

---

### To change the echo detection mode

1. Press [2nd F], [ZOOM] (E-TO-E).

2. In the menu, select the desired echo detection mode (**STANDARD**, **AUTO E-TO-E**, or **MANUAL E-TO-E**).
3. To perform the zero calibration again:
  - a) Place a drop of couplant on the surface of the thin part of the test block.
  - b) Couple the transducer to the thin part of the test block, and then press **[CAL ZERO]**.
  - c) When the thickness reading is stable, press **[ENTER]**.
  - d) Using the arrow keys, edit the thickness value to match the known thin thickness of the test block.

### 5.6.1 Blanking Adjustments in Manual Echo-to-Echo Detection Mode

The 38DL PLUS offers two blanking functions to help detect valid echoes in situations where material conditions generate unwanted signals:

#### EXT BLANK

The extended blank creates a blanked zone that begins at the left edge of the waveform display and in which no signals are detected. In situations where the second or third pair of back-wall echoes are stronger or cleaner than the first pair, use the extended blank to control which pair of echoes to use for measurement.

#### E1 BLANK

The echo 1 (E1) blank runs for a selected interval following the first detected echo. Use the E1 blank to exclude any unwanted peaks occurring between the first and the second back-wall echoes. Unwanted peaks may be trailing edges of a large first echo, or shear wave reflections on thick test pieces. The E1 blank parameter is only available in the manual echo-to-echo detection mode.

#### To adjust the extended and the E1 blank parameters

1. Select the manual echo-to-echo mode:
  - a) Press **[2nd F]**, **[ZOOM]** (**E-TO-E**).
  - b) In the menu, select **MANUAL E-TO-E**.
2. Press **[WAVE ADJ]**.

The wave adjustment parameter appears (see Figure 5-15 on page 84).

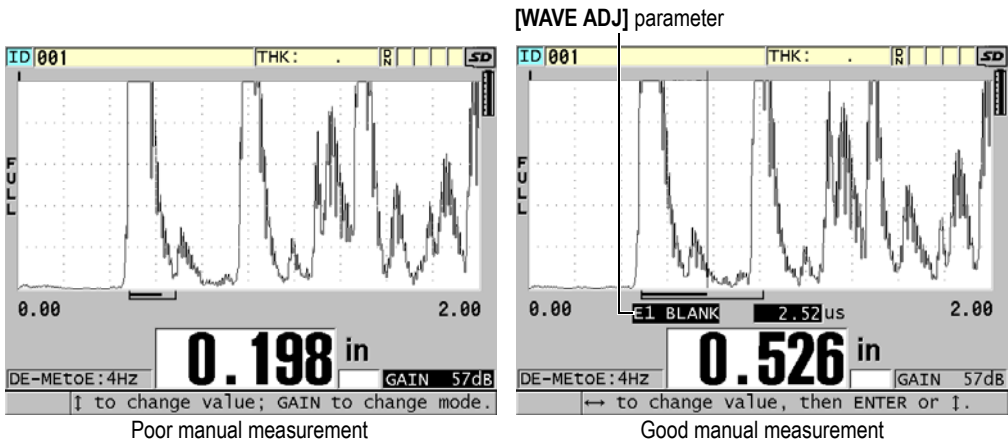


Figure 5-15 Comparing manual measurements

3. Use the [ $\blacktriangle$ ] and [ $\blacktriangledown$ ] keys to select either the EXT BLANK or the E1 BLANK parameter.
4. Use the [ $\blacktriangleright$ ] and [ $\blacktriangleleft$ ] keys to adjust the value to exclude unwanted peaks and detect the desired echoes.

## 5.6.2 Dual Element Transducer Selection in Echo-to-Echo Modes

Although the echo-to-echo modes work with all of the 38DL PLUS dual element transducers, Olympus recommends using particular transducers for specific thickness ranges in steel parts (see Table 3 on page 84).

Table 3 Recommended transducers for various steel thickness ranges

Transducer type	Thickness range <sup>a</sup>
D798	1.5 mm to 7.6 mm (0.060 in. to 0.300 in.)
D790/791	2.5 mm to 51 mm (0.100 in. to 2.00 in.)
D797	12.7 mm to 127 mm (0.500 in. to 5.00 in.)
D7906	2.5 mm to 51 mm (0.100 in. to 2.00 in.)

- a. Thickness ranges are dependent on transducer type, material conditions, and temperature.

In some cases, an error can occur if you are using a D790 transducer to measure thicknesses above 18 mm (0.7 in.). Typically, this error is due to a mode-converted shear-wave echo that may appear before the second back-wall echo. If this unwanted echo is larger than the second back-wall echo, the gage measures to it, which produces a thinner reading.

You can usually distinguish the unwanted shear-wave echo from the correct back-wall echo by examining the waveform display. The distance between the first and the second back-wall echoes is the same as the distance between the zero thickness point and the first back-wall echo. If there is an echo between the first two back-wall echoes, it is probably a mode-converted shear-wave echo. Use the manual echo-to-echo detection mode techniques and manually adjust the E1 blank to eliminate this error (see “Blanking Adjustments in Manual Echo-to-Echo Detection Mode” on page 83). Using the D797 transducer beyond 18 mm (0.7 in.) helps to eliminate the possibility of this error.

In some cases, the second or third back-wall echo is smaller in amplitude than subsequent echoes. This causes the instrument to give a double or triple reading. If you are using a D790 transducer, this effect may occur around 5 mm (0.2 in.) on flat smooth steel samples. If this occurs, it is clearly visible on the waveform display and you can work around it using the manual echo-to-echo detection mode, or moving the extended blank beyond the previously detected first echo.

When the 38DL PLUS cannot make an echo-to-echo reading, the LOS flag appears on the screen. In this case, the waveform display shows that either no echoes are large enough to be detected or that only one echo is detectable. In this last case, the echo-to-echo detection bar begins at the detected echo but extends indefinitely to the right. Increase the gain value to make a good echo-to-echo reading. If this does not help, you can still obtain an approximate measurement by returning to the standard echo detection mode.

### 5.6.3 Echo-to-Echo Mode Datalogger Flags

The following flags are used in the echo-to-echo modes in the first flag field of the uploaded thickness table and in the comment note box at the top right corner of the measurement screen:

- **E**: Automatic echo-to-echo detection mode
- **e**: Manual echo-to-echo detection mode
- **M**: Standard detection mode
- **I**: LOS in automatic echo-to-echo detection mode

- **n**: LOS in manual echo-to-echo detection mode
- **L**: LOS in standard echo detection mode

## 5.7 Using the VGA Output

You can connect the 38DL PLUS to an external screen or projector to more easily show the content of the 38DL PLUS screen to other people. This feature is particularly useful when you need to train other 38DL PLUS users.

When you activate the VGA output, the 38DL PLUS screen becomes blank and its contents appears only on the connected external screen. The VGA output is always turned off when you restart the 38DL PLUS.

### To use the VGA output

1. Turn off the 38DL PLUS.
2. Connect the optional VGA output cable (P/N: EPLTC-C-VGA-6 [U8840035]) to the VGA output connector, located under the I/O door on the right side of the 38DL PLUS (see Figure 1-5 on page 25).
3. Connect the other end of the VGA output cable to the external screen or projector.
4. Turn on the 38DL PLUS.
5. Turn on the external screen or projector.
6. Press **[DISPLAY]**.
7. In the **DISPLAY SETTINGS** screen (see Figure 4-3 on page 52), set **VGA OUTPUT** to **ON**.  
The 38DL PLUS screen becomes blank and the 38DL PLUS screen contents appears on the external screen.
8. Turn the instrument off and then back on if you need to restore the contents on the 38DL PLUS screen.

## Appendix: Technical Specifications

**Table 4 General EN15317 specifications**

Parameter	Value
Size	Height × Width × Depth Without protective boot: <ul style="list-style-type: none"> <li>• 211.6 mm × 128.1 mm × 46.2 mm (8.33 in. × 5.04 in. × 1.82 in.)</li> </ul> With the rubber protective boot: <ul style="list-style-type: none"> <li>• 236.2 mm × 130.6 mm × 66.5 mm (9.30 in. × 5.14 in. × 2.62 in.)</li> </ul>
Weight	816.5 g (1.80 lb)
Power supply types	AC-DC adaptor 24 V Lithium-ion battery 24.42 Wh Five AA auxiliary batteries
Probe sockets types	Dual LEMO with center pin IP67
Battery operating time Lithium-ion	12.6 hours minimum 14 hours typical 14.7 hours maximum
Operating temperature	With lithium-ion battery: -10 °C to 50 °C (14 °F to 122 °F)
Battery storage temperature	-20 °C to 40 °C (-4 °F to 104 °F)
Battery indicator	8-step battery charge level indication Flashing low-battery warning
Pulse repetition frequency (PRF)	1 kHz burst Measurement rates: 4 Hz, 8 Hz, 16 Hz, 20 Hz, and 30 Hz
Alarm indicators	Visual high-alarm and low- alarm indicators with audio tone
Thru coating	Echo-to-echo measurement and THRU-COAT

**Table 4 General EN15317 specifications (continued)**

Parameter	Value
Minimum and maximum thickness	Single element: 0.1 mm to 635.0 mm (0.004 in. to 25 in.) Dual element: 0.5 mm to 635.0 mm (0.020 in. to 25 in.)

**Table 5 Display EN15317 specifications**

Parameter	Value
Type	Color graphical TFT, LCD, 640 × 480 pixels
Size	[Height] × [Width], [Diagonal] 56.16 mm × 74.88 mm, 93.6 mm (2.21 in. × 2.94 in., 3.68 in)

**Table 6 Transmitter EN15317 specifications**

Parameter	Value
Transmitter pulse	Adjustable square wave pulser
Pulser voltage	Pulse voltages: 60 V, 110 V, 150 V, and 200 V
Pulse rise time	Damping in: 5 ns typical Damping out: 3.5 ns typical (pulse width dependent)
Pulse duration	Adjustable to probe frequency

**Table 7 Receiver EN15317 specifications**

Parameter	Value
Gain control	Automatic or manual: 0 dB to 99 dB
Frequency range	0.5 MHz to 24 MHz typical (filter dependent)

**Table 8 Other EN15317 specifications**

Parameter	Value
Data storage	Internal and external 2 GB microSD memory cards. Each card: 475000 thickness readings or 20000 waveforms with thickness readings

**Table 8 Other EN15317 specifications (continued)**

Parameter	Value
Data output types	2.0 USB client RS-232 Removable microSD memory card
Calibration setting storage	Default single and dual element transducer setups 35 custom single element and 10 custom dual element storage locations
Calibration	Single or two-point calibration test block Velocity can be entered manually. Multi-points for custom V-path calibration with dual element transducers
Display response time	Adjustable 4 Hz, 8 Hz, 16 Hz, 20 Hz, and 30 Hz
Number of pixels to display a waveform	640 × 480 pixels
Printer output	RS-232 serial

**Table 9 Environmental rating specifications**

Parameter	Value
IP rating	Designed for IP67
Explosive atmosphere	MIL-STD-810F, Section 511.4, Procedure I
Shock test	MIL-STD-810F, Section 516.5, Procedure I
Vibration test	MIL-STD-810F, Section 514.5, Procedure I
Drop test	MIL-STD-810F, Section 516.5, Procedure IV- Transit Drop

**Table 10 Measurement specifications**

Parameter	Value
Measurement modes	<p><b>Standard dual element:</b> Time between excitation pulse and first back-wall echo using dual element transducer.</p> <p><b>Dual echo-to-echo:</b> Time between successive back-wall echoes using dual element transducers.</p> <p><b>Thru-coat:</b> Time between excitation pulse and first back-wall echo while ignoring or displaying a coating thickness.</p> <p><b>Mode 1:</b> Time between excitation pulse and first echo following blank period using contact transducers.</p> <p><b>Mode 2:</b> Time between the interface echo and the first back-wall echo. Normally used with delay line or immersion transducers.</p> <p><b>Mode 3:</b> Time between a pair of back-wall echoes following the interface echo. Normally used with delay line or immersion transducers.</p>
V-path correction	Automatic or manually created, dependent on transducer type
Measurement resolution	Selectable from the keypad: <b>LOW:</b> 0.1 mm (0.01 in.) <b>STD:</b> 0.01 mm (0.001 in.) <b>HI:</b> 0.001 mm (0.0001 in.) with high resolution option. Not all resolutions are available for all measurement modes
Material sound velocity range	0.762 mm/ $\mu$ s to 13.999 mm/ $\mu$ s (0.0300 in./ $\mu$ s to 0.5511 in./ $\mu$ s)
Material sound velocity resolution	0.001 mm/ $\mu$ s (0.0001 in./ $\mu$ s)
Alarm set points range	0.00 mm to 635.00 mm (0.00 in. to 25.00 in.)

**Table 11 Datalogger specifications**

Parameter	Value
Storage capacity	475000 thickness readings or 20000 waveforms with thickness readings
ID number length	1 to 20 characters
File name length	1 to 32 characters

**Table 11 Datalogger specifications (continued)**

Parameter	Value
File formats	Incremental Sequential (defined by starting and ending ID number) Sequential with custom points 2-D grid 2-D grid with custom points 3-D grid 3-D custom Boiler
External memory card	microSD memory card 2 GB maximum capacity

**Table 12 Typical measurement ranges and default setups for a single element transducer<sup>a</sup>**

Setup name	Transducer	Typical measurement range
DEFM1-20.0-M116	M116	Steel: 0.250 mm to 8.000 mm (0.020 in. to 1.500 in.)
DEFM1-10.0-M112	M112	Steel: 0.760 mm to 250.000 mm (0.030 in. to 10.000 in.)
DEFM1-10.0-M1016	M1016	Steel: 0.760 mm to 250.00 mm (0.030 in. to 10.000 in.)
DEFM1-5.0-M110	M110	Steel: 1.00 mm to 380.00 mm (0.040 in. to 15.000 in.)
DEFM1-5.0-M109	M109	Steel: 1.00 mm to 500.00 mm (0.050 in. to 20.000 in.)
DEFM1-2.25-M106	M106	Steel: 2.00 mm to 635.00 mm (0.080 in. to 25.000 in.)
DEFM1-2.25-M1036	M1036	Steel: 2.00 mm to 635.00 mm (0.080 in. to 25.000 in.)
DEFM3-20.0-M208	M208	Steel: 0.25 mm to 5.00 mm (0.008 in. to 0.200 in.)
DEFP2-20.0-M208	M208	Plastic: 0.12 mm to 5 mm (0.005 in. to 0.200 in.)
DEFM3-10.0-M202	M202	Steel: 0.25 mm to 12.00 mm (0.010 in. to 0.500 in.)
DEFM2-10.0-M202	M202	Steel: 0.75 mm to 12.00 mm (0.030 in. to 0.500 in.)
DEFP2-10.0-M202	M202	Plastic: 0.6 mm to 6 mm (0.025 in. to 0.25 in.)
DEFM3-15.0-V260	V260	Steel: 0.25 mm to 5.00 mm (0.010 in. to 0.200 in.)
DEFM2-15.0-V260	V260	Steel: 0.75 mm to 12.50 mm (0.030 in. to 0.500 in.)
DEFP2-15.0-V260	V260	Plastic: 0.25 mm to 3 mm (0.010 in. to 0.120 in.)
DEFM2-5.0-M201	M201	Steel: 1.50 mm to 25.40 mm (0.050 in. to 1.000 in.)
DEFP2-5.0-M201	M201	Plastic: 0.62 mm to 12.5 mm (0.025 in. to 0.500 in.)
DEFM2-5.0-M206	M206	Steel: 1.25 mm to 19.00 mm (0.050 in. to 0.750 in.)
DEFP2-5.0-M206	M206	Plastic: 1 mm to 12.5 mm (0.040 in. to 0.500 in.)

**Table 12 Typical measurement ranges and default setups for a single element transducer<sup>a</sup> (continued)**

Setup name	Transducer	Typical measurement range
DEFM2-2.25-M207	M207	Steel: 2.00 mm to 19.00 mm (0.080 in. to 0.750 in.)
DEFP2-2.25-M207	M207	Plastic: 2 mm to 12.5 mm (0.080 in. to 0.500 in.)
DEFM2-20.0-M208	M208	Steel: 0.50 mm to 10.00 mm (0.020 in. to 0.200 in.)
DEFM1-0.5-M101	M101	Steel: 12.5 mm to 635 mm (0.500 in. to 25.00 in.)
DEFM1-1.0-M102	M102	Steel: 5.0 mm to 635 mm (0.200 in. to 25.00 in.)
DEFM1-1.0-M103	M103	Steel: 2.5 mm to 635 mm (0.100 in. to 25.00 in.)
DEFP1-0.5-M2008	M2008	Fiberglass: 5.0 mm to 75 mm (0.200 in. to 3.00 in.)

- a. The maximum thickness measuring capability depends on transducer type, material conditions, and temperature.

**Table 13 Setup parameter description**

Name	Description	Units/Resolutions/Range
<b>MEAS OPTION</b>	Echo detect mode	Standard dual Dual echo-to-echo Thru-Coat Mode 1 Mode 2 Mode 3
<b>MEAS TYPE</b>	Special measurement modes	Standard or Oxide (optional) Barrier Layer (optional) First Peak
<b>PROBE TYPE</b>	Transducer types	Dual element Direct contact Delay line Immersion EMAT
<b>PULSER POWER</b>	Pulser power	60 V, 110 V, 150 V, or 200 V
<b>MAX GAIN</b>	Maximum receiver gain	0.0 dB to 99.8 dB, 0.3 dB steps
<b>INIT GAIN</b>	Initial TDG gain	0 to MaxGain, 1 dB steps.
<b>TDG SLOPE</b>	Time Gain slope (default)	0.0 dB/s to 39.9 dB/s
<b>MB BLANK</b>	Main Bang Blank	0 ns to 225 $\mu$ s

**Table 13 Setup parameter description (continued)**

Name	Description	Units/Resolutions/Range
<b>ECHO WINDOW</b>	Echo detect gate which begins at end of MB (main bang) blank in mode 1 or interface echo in modes 2 and 3. The value reported for the end of echo window is relative to the main bang.	0 ns to 224.71 $\mu$ s. 55 ns or MB blank time interval, whichever is less.
<b>ECHO 1 DETECT</b>	Detection polarity of first echo	+ or -
<b>ECHO 2 DETECT</b>	Detection polarity of second echo	+ or -
<b>IF BLANK</b>	Blank after interface echo	0 $\mu$ s to 20 $\mu$ s
<b>M3 BLANK</b>	Blank after first measured back-wall echo in mode 3	0 $\mu$ s to 20 $\mu$ s
<b>VELOCITY</b>	Ultrasonic sound velocity of material to be measured	0.508 mm/ $\mu$ s to 18.699 mm/ $\mu$ s (0.0200 in./ $\mu$ s to 0.7362 in./ $\mu$ s)
<b>ZERO</b>	Zero calibration factor	0.00 to 999.99

**Table 14 General specifications**

Element	Description
<b>Keypad</b>	Sealed and embossed membrane surface Tactile and audible feedback, color-coded graphics, 21 keys
<b>Dual element transducers</b>	Automatically identifies the transducer type and optimizes the gate for that transducer. Non-Olympus transducers might work, but performance is not guaranteed. Following transducers are supported: D790, D790-SM, D791, D791-RM, D792, D793, D794, D795, D797, D798, D7906-SM, D7908, D799, D7912, D7913, and MTD705
<b>Single element transducers</b>	Can be used with contact, delay line, and immersion transducers from 2 MHz to 30 MHz. High precision software option expands the frequency range to 0.5 MHz to 30.0 MHz



---

## List of Figures

---

Figure i-1	The warning symbol between the T/R connectors .....	1
Figure i-2	Labels and symbols are attached to the instrument .....	2
Figure i-3	The 38DL PLUS instrument .....	17
Figure 1-1	Measuring thicknesses with the 38DL PLUS .....	20
Figure 1-2	The 38DL PLUS hardware components .....	23
Figure 1-3	The 38DL PLUS connections .....	24
Figure 1-4	The top end connectors .....	25
Figure 1-5	The connectors behind the I/O door .....	25
Figure 1-6	The 38DL PLUS keypads .....	26
Figure 2-1	The power indicator for battery and AC operation .....	31
Figure 2-2	Connecting the charger/adaptor .....	32
Figure 2-3	Connecting the DC power plug .....	33
Figure 2-4	Opening the battery compartment .....	36
Figure 2-5	Selecting the new battery type .....	37
Figure 3-1	The main elements of the measurement screen .....	39
Figure 3-2	The ID bar .....	40
Figure 3-3	Example of other elements appearing on the measurement screen .....	41
Figure 3-4	The loss-of-signal (LOS) indicator .....	41
Figure 3-5	Menu and submenu example .....	42
Figure 3-6	Parameter screen example .....	43
Figure 3-7	Example of the virtual keyboard .....	45
Figure 3-8	The character cycle of the traditional text edit method .....	46
Figure 4-1	Selecting the user interface language .....	50
Figure 4-2	Selecting clock parameters .....	51
Figure 4-3	The DISPLAY SETTINGS screen .....	52
Figure 4-4	Example of the indoor and the outdoor color schemes .....	53
Figure 4-5	Examples of the rectification modes .....	54
Figure 4-6	Examples of waveform trace modes .....	56
Figure 4-7	The range of the waveform display .....	57
Figure 4-8	Comparing normal and zoomed display in mode 1 .....	59

Figure 4-9	Comparing normal and zoomed display in mode 2 .....	59
Figure 4-10	Comparing normal and zoomed display in mode 3 .....	60
Figure 4-11	The measurement update rate indicator .....	60
Figure 5-1	Plugging the transducer .....	64
Figure 5-2	Initial screen with a standard D79X dual element transducer .....	64
Figure 5-3	Selecting a default single element transducer setup .....	65
Figure 5-4	Performing the material sound velocity calibration on a 5-step test block .....	68
Figure 5-5	Performing the zero calibration on a 5-step test block .....	69
Figure 5-6	Example of a 5-step test block .....	70
Figure 5-7	Entering a known material sound velocity .....	72
Figure 5-8	The calibration lock message .....	73
Figure 5-9	Coupling dual element transducer and reading the measured thickness .....	76
Figure 5-10	The active file name appearing in the ID bar .....	77
Figure 5-11	Opening the THRU COAT SETUP dialog box .....	78
Figure 5-12	Measuring with the standard echo detection mode .....	80
Figure 5-13	Measuring with the automatic echo-to-echo detection mode .....	81
Figure 5-14	Measuring with the manual echo-to-echo detection mode .....	82
Figure 5-15	Comparing manual measurements .....	84

---

## List of Tables

---

Table 1	Label contents .....	3
Table 2	Keypad functions .....	27
Table 3	Recommended transducers for various steel thickness ranges .....	84
Table 4	General EN15317 specifications .....	87
Table 5	Display EN15317 specifications .....	88
Table 6	Transmitter EN15317 specifications .....	88
Table 7	Receiver EN15317 specifications .....	88
Table 8	Other EN15317 specifications .....	88
Table 9	Environmental rating specifications .....	89
Table 10	Measurement specifications .....	90
Table 11	Datalogger specifications .....	90
Table 12	Typical measurement ranges and default setups for a single element transducer .....	91
Table 13	Setup parameter description .....	92
Table 14	General specifications .....	93



---

# Index

---

## A

AA battery holder 33  
AC power 32  
    cord 24  
    using 32  
acoustic properties of test material 74  
activating  
    zoom 58  
active file name 77  
adjusting  
    delay value 58  
    extended and E1 blanks 83  
    update rate 61  
alarm indicator 41  
Alkaline batteries  
    operating time 34  
    using 33  
arrow keys 27  
A-scan 40  
Australia, RCM compliance 4  
AUTO E-TO-E 81

## B

basic operation 63  
battery  
    charge 31  
    charging 34  
    compartment door 36  
    full capacity 35  
    operating time 34  
    power 33  
    precautions 10  
    rechargeable 33

    replacement 36  
    storage instructions 35  
    usage instructions 35  
beeper 49  
blank  
    adjusting 83  
    thickness value 77  
brightness, display 52

## C

calibration 66, 73  
    instrument 67  
    locked 73  
    material sound velocity 71  
    test block 70  
    THRU-COAT 79  
    transducer zero compensation 70  
caution notes  
    AC power cord 24, 32  
    battery replacement 36  
    ingress protection guarantee 23  
CAUTION signal word 8  
cautions  
    instrument compatibility 6  
    modification prohibited 7  
CE (European Community) 11  
CE marking 4  
changing  
    display settings 51  
    echo detection mode 82  
    language 49  
    thickness measurement resolution 61  
character

- cycle in traditional method 46
- deleting 47
- inserting 47
- charging batteries 34
- China RoHS 4, 12
- Chinese keypad 26
- clock
  - setting 51
- coated material 78
- color scheme 52
  - changing 51
- comment notes 40, 85
- compliance
  - EMC directive 13
  - FCC (USA) 13
  - ICES-001 (Canada) 14
  - RCM (Australia) 4
- configuring
  - beeper 49
  - inactive time 49
  - radix type 49
- connections 24
- corrosion applications 78
- couplant types 76
- coupling technique 73
- curvature of test piece 74

**D**

- danger notes
  - electric shock 1
- DANGER signal word 8
- data
  - saving 77
- datalogger
  - echo-to-echo flags 85
  - file based system 76
  - functions 22
- date, setting 51
- DC power connector 25
- DE-AEtoE indicator 81
- default file 77
- delay 56
  - adjusting value 58
- deleting
  - a character 47
- DE-MEtoE indicator 81

- DE-STD indicator 80
- direct current symbol 4
- display
  - brightness 52, 53
  - changing settings 51
  - options 21
- disposal, equipment 11
- documentation CD 19
- doubling 85
- download indicator 40
- dual element transducer
  - connector 24
  - selection for echo-to-echo modes 84
  - zero compensation 66, 70

**E**

- E1 blank
  - adjusting 83
  - description 83
- eccentricity or taper 74
- echo detection mode 80
  - changing 82
- echo-to-echo mode
  - blanking adjustments 83
  - flags 85
- editing
  - value with traditional method 47
  - value with virtual keyboard 45
- electric shock, danger note 1
- EMC directive compliance 13
- EN15317 specifications 87
- enabling THRU-COAT 78
- English keypad 26
- entering known material sound velocity 72
- environmental rating 22
- equipment disposal 11
- error messages
  - calibration 69
- European Community (CE) 11
- extended blank
  - adjusting 83

**F**

- fast mode 60
- FCC (USA) compliance 13
- FCC symbol 4

- 
- file name 77
  - filled waveform 56
  - flags, echo-to-echo 85
  - freeze indicator 41
  - full rectification 54
  - G**
  - GageView
    - manual 6
  - getting started manual 6
  - H**
  - half- rectification 54
  - half+ rectification 54
  - hand strap 23
  - help text bar 41
  - high resolution software option 61
  - high temperature measurements 71
  - I**
  - I/O door 25
  - ICES-001 (Canada) compliance 14
  - ID bar 39, 40
  - ID number 40
  - important information 5
  - important notes
    - turning off before procedure completion 69
    - user's manual 19
  - IMPORTANT signal word 8
  - inactive time 49
  - indicators
    - alarm 41
    - DE-AEtoE 81
    - DE-MEtoE 81
    - DE-STD 80
    - download 40
    - freeze 41
    - LOS 41
    - microSD card 40
    - power 31, 39
    - rectification 39
    - zoom 41
  - indoor color scheme 53
  - initial screen 64
  - inserting a character 47
  - instruction label
    - content 3
    - location 2
  - instruction manual 5
  - instrument
    - calibrating 67
  - international keypad 26
  - IP67 ingress protection 22
  - J**
  - Japanese keypad 26
  - K**
  - keypad 26
    - functions 26, 27
    - secondary function 27
  - known material sound velocity 72
  - L**
  - labels
    - instructions 2, 3
    - safety 1
  - language, changing 49
  - last ID 77
  - loading, setup 65
  - locked calibration 73
  - loss-of-signal indicator 41
  - M**
  - MANUAL E-TO-E 81
  - manual, instruction 5
  - material
    - coated or painted 78
    - entering sound velocity 72
    - sound velocity calibration 66, 68, 71
  - measurement
    - features 20
    - update rate 60
  - measurement screen 39
  - measuring thickness 75
  - membrane vent 4
  - memory card
    - indicators 40
    - microSD 24
    - slot 25
  - menus 41
    - selecting a ~ command 42
  - mode 1 59
-

mode 2 59  
mode 3 60  
modification, instrument 7

## N

NiMH rechargeable batteries 33  
  operating time 34  
NONAME00 default file 77  
NOTE signal word 8  
notes  
  alarm colors only with indoor color scheme 53  
  battery charge cycles 35  
  battery not initially fully charged 33  
  calibration error 69  
  couplant types 76  
  display brightness and battery life 54  
  entering known material sound velocity 80  
  filled waveform trace condition 55  
  fully charge battery after replacement 37  
  fully charged battery 35  
  high temperature measurement 71  
  menu selection writing convention 42  
  move to the next line in text edit 46  
  parameter selection writing convention 44  
  user defined setups 66  
notes, information  
  signal words 8

## O

Olympus technical support 15  
outdoor color scheme 53  
outline waveform 56

## P

painted material 78  
parameter  
  screens 42  
  selecting 43  
patent label 2  
performing  
  THRU-COAT calibration 79  
phase  
  distortion 75  
  reversal 75  
power

AC 32  
battery 33  
  indicator 31, 39  
precautions  
  battery 10  
  safety 9  
product description 19  
protective rubber boot 23

## R

radix type 49  
range 56  
  selecting value 57  
RCM mark 4  
rectification  
  changing setting 52  
  indicator 39  
  mode 54  
repair, instrument 7  
replacing the battery 36  
resolution, changing 61  
RF rectification 54  
RoHS symbol 4, 12

## S

safety  
  instrument compatibility 6  
  labels and symbols 1  
  misuse of instrument 5  
  precautions 9  
  signal words 7  
  symbols 7  
saving  
  data 77  
secondary key function 27  
selecting  
  menu command 42  
  parameter and value 43  
  range value 57  
  text edit mode 44  
serial communication connector 25  
serial number  
  label content 3  
  label location 2  
setting  
  clock 51

- transducer 63
- units 50
- setups
  - loading 65
- shear-wave, unwanted 85
- signal words
  - information notes 8
    - IMPORTANT 8
    - NOTE 8
    - TIP 9
  - safety 7
    - CAUTION 8
    - DANGER 8
    - WARNING 8
- software options
  - high resolution 61
- sound
  - attenuation or absorption 74
  - scattering 74
  - velocity calibration 66, 71
- stand 23
- standard echo detection mode 80
- step test block 70
- strap rings 23
- submenus 41
- support information, technical 15
- surface roughness of test piece 73
- symbols
  - CE 4
  - direct current 4
  - FCC 4
  - RCM (Australia) 4
  - RoHS 4, 12
  - safety 1, 7
  - WEEE 4
- T**
  - T/R transducer connector 25
  - taper or eccentricity 74
  - technical specifications 87
  - technical support 15
  - test block 70
  - test piece, curvature of 74
  - text edit
    - mode selection 44
  - traditional method 46
  - virtual keyboard 44
- thickness
  - measuring 75
  - resolution 61
- THRU-COAT
  - enabling 78
  - measurement 78
  - performing calibration 79
- time, setting 51
- tip notes
  - save both thickness value and waveform 78
  - switching between echo detection modes 82
- TIP signal word 9
- title bar 43
- traditional text edit method 46, 47
- transducer
  - setting 63
- U**
  - units, setting 50
  - unwanted shear-wave echo 85
  - update rate 60
    - adjusting 61
  - USB
    - client connector 25
    - connector 24
  - USB/RS-232 connector 24, 25
  - use, intended 5
  - user interface language 49
  - user's manual 6
  - using
    - AC power 32
    - VGA output 86
- V**
  - velocity
    - calibration 66, 71
    - variations 75
  - VGA output
    - activating 52
    - connector 24, 25
    - using 86
  - virtual keyboard 44
    - editing value 45

## **W**

- warning notes
  - charger/adapter usage 34
- WARNING signal word 8
- warning symbols
  - general 7
  - shock hazard 7
- warnings
  - electrical 10
  - general 9
  - misuse of instrument 5
- warranty information 14
- waste electrical and electronic equipment 12
- waveform
  - delay 56
  - display 39

- range 56
- rectification 54
- rectification, changing 52
- trace 40, 55
  - trace, changing 52
- WEEE directive 12
  - symbol 4

## **Z**

- zero calibration 66, 69
- zero compensation 66
- zoom
  - activating 58
  - indicator 41
- zoomed display 59